Rockville Centre Union Free School District

Districtwide Lead in Drinking Water Sampling and Remediation Plan

September 2020



2150 Smithtown Avenue Ronkonkoma, NY 11779 (631) 580-3191 www.envirohealth.org

Project #19403

<u>Districtwide Lead in Drinking Water</u> <u>Sampling and Remediation Plan</u>

Performed for:

Rockville Centre Union Free School District 128 Shepherd Street Rockville Centre, NY 11570

September 2020 (updated April 5, 2021)

Prepared by:

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779 (631) 580-3191

Grenn Huschel

Project #19403

President

Glenn Neuschwender



Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

1	Fyec	utive	Sum	marv
	LVCC	utive	Juli	ıııaı y

- **II. Sampling Methodology**
- **III. Initial Results**

Appendix A – Floyd B. Watson Elementary School

Appendix B – Francis F. Wilson Elementary School

Appendix C – Jennie E. Hewitt Elementary School

Appendix D – Riverside Elementary School

Appendix E- William S. Covert School

Appendix F- South Side Middle School

Appendix G – South Side High School





October 19, 2020

John Scalisi Rockville Centre UFSD 128 Shepherd Street Rockville Centre, NY 11570

I. Executive Summary

Rockville Centre UFSD has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

The following locations within the Rockville Centre UFSD buildings have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Classroom sinks
- 5) Bathroom sinks
- 6) Nurse's Office Sinks
- 7) Faculty Room sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. The chains of custody are available upon request. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.



The following locations within the Rockville Centre UFSD buildings were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory Sinks
- 2) Outside Spigots
- 3) Custodial Closet Sinks

In these cases, the Rockville Centre staff have placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Outside spigots all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Custodial Closet sinks these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

II. Sampling Methodology

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Rockville Centre UFSD buildings from March 26 to April 1 and on September 25, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.



Fixture Type Codes

Source Designations

Remediation Type Codes

BF Bottle Filler App Applicable
HB Hose Bib N/A Non-applicable

IM Ice Machine
OS Other Source

PF Pot Filler

SK Sink

V

SL Supply Line

SP Spigot FR Fixture Replacement

SPY Spray FRSLV Fixture, supply line or valve replacement SS Slop Sink FRSLVPA Fixture, supply line or valve replacement


Valve plumbing assessment

WC Water Cooler SIGN Non-potable water sign posted

WF Water Fountain CAPPED Supply line capped or fixture removed



Sampling Location Schematics

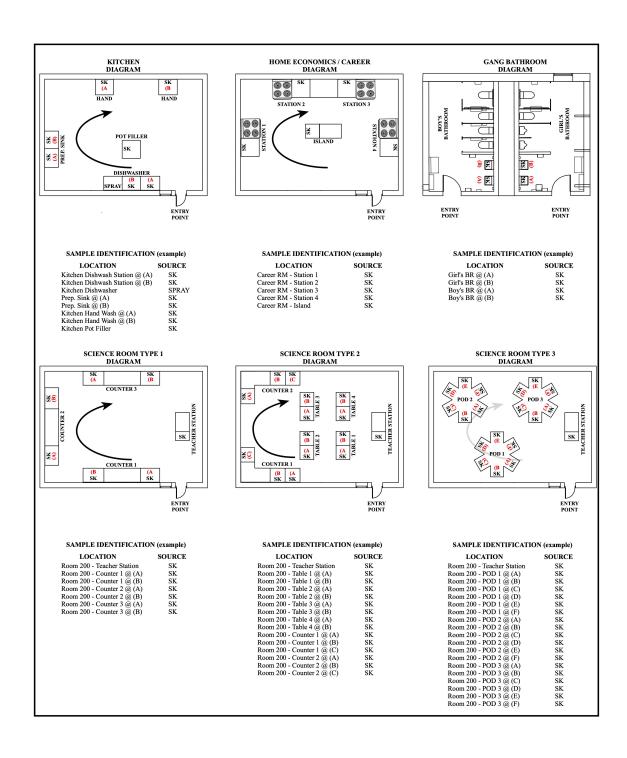



III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through G).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

Floyd B. Watson Elementary School

No Exceedances

Francis F. Wilson Elementary School

Room 1	SK	16.3
Portable C Bathroom	SK	35.4

Jennie E. Hewitt Elementary School

Nurse's Isolation Room @ B	SK	19.8
----------------------------	----	------



Riverside Elementary School

Kitchen Hand Wash	SK	20.5
Room 12	WF	40.4

William S. Covert Elementary School

Room 109	SK	35.2
Room 111	SK	15.5
Room 115	WF	15.3
Room 116	SK	15.4

South Side Middle School

Room 116 Unit 1 @ A	SK	33.4
Room 308 Teacher's Station	SK	23.9
Room 308 Counter 3	SK	35.9
Room 309 Teacher's Station	SK	17.5
Room 309 Counter 2	SK	81.8
Room 309 Counter 3 @ B	SK	15.5
Room 309 Counter 3 @ C	SK	43.8
Room 309 Counter 3 @ D	SK	73.7
Room 307 Teacher's Station	SK	35.4
Room 307 Counter 1	SK	321
Room 307 Counter 2	SK	24.1
Room 305 Counter 1 @ B	SK	23.4
Room 305 Counter 1 @ D	SK	60.1



South Side High School

Boy's Locker Room Coach's Bathroom	SK	30.2
Room 1314 Handwash	SK	83.4
Room 1327 Teacher's Station	SK	31.4
Room 1327 Counter	SK	15.4
Hall by Room 1321	SK	23.7
Room 1408 Pod 1 @ A	SK	50.6
Room 1408 Pod 1 @ B	SK	23.6
Room 1408 Pod 3 @ A	SK	17.9
Room 1408 Pod 5 @ B	SK	16.2
Room 1408 Pod 6 @ A	SK	16.5
Room 1408 Pod 6 @ B	SK	21.4
Room 1402 Pod 1 @ B	SK	19.8
Room 1402 Pod 2 @ B	SK	17.6
Room 2105 Unit @ A	SK	21.1
Room 2105 Unit @ B	SK	19.6
Room 2105 Unit @ C	SK	26.7
Room 2103 Unit @ A	SK	20.2
Room 2103 Unit @ B	SK	27.4
Room 2103 Unit @ C	SK	30.3
Room 2301	SK	20.9
Room 2414 Fume Hood	SP	15.7
Room 2410 Fume Hood	SP	27.9
Room 2406 Prep Fume Hood	SK	46.3
Room 2404 Counter	SK	181

Appendix A



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Prep-3 Sink	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1001-2	Kitchen Prep-3 Sink	SPY	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1001-3	Kitchen Hand Wash	SK	Арр	1.98	3/31/2020	-	-	-		-	-	-
1002-1	Bathroom off of Gym & Boiler Room	SK	Арр	1.76	3/31/2020	-	-	-		-	-	-
1003-1	Room 109	SK	Арр	2.65	3/31/2020	-	-	-		-	-	-
1003-2	Room 109	WF	Арр		3/31/2020	-	-	-		Removed from Service	-	-
1004-1	Faculty Room	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1004-2	Faculty Room	SPY	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1004-3	Faculty Room Bathroom	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1005-1	Room 108	SK	Арр	2.18	3/31/2020	-	-	-		-	-	-
1005-2	Room 108	WF	Арр	1.33	3/31/2020	-	-	-		-	-	-
1006-1	Hallway By Custodial Office/Boiler Room	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1006-2	Hallway By Custodial Office/Boiler Room	BF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1007-1	Room 107	SK	Арр	1.67	3/31/2020	-	-	-		-	-	-
1007-2	Room 107	WF	Арр		3/31/2020	-	-	-		Removed from Service	-	-
1008-1	Room 126-Guided Reading Bathroom	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1009-1	Main Office Bathroom	SK	Арр	1.3	3/31/2020	-	-	-		-	-	-
1010-1	Room 104	SK	Арр	2.12	3/31/2020	-	-	-		-	-	-
1010-2	Room 104	WF	Арр	2.02	3/31/2020	-	-	-		-	-	-
1011-1	Hallway by Room 103	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-1	Room 103	SK	Арр	1.16	3/31/2020	-	-	-		-	-	-
1013-1	Room 102	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1014-1	Staff Bathroom by Room 101	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1015-1	Room 110	SK	Арр	1.64	3/31/2020	-	-	-		-	-	-
1015-2	Room 110	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1016-1	Room 111	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1016-2	Room 111	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1017-1	Room 112	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1017-2	Room 112	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1018-1	Room 113	SK	Арр	2.85	3/31/2020	-	-	-		-	-	-
1018-2	Room 113	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1019-1	Room 101	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1020-1	Room 122	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1021-1	Room 121	SK	Арр	1.03	3/31/2020	-	-	-		-	-	-
1021-2	Room 121	WF	Арр	14.4	3/31/2020	-	-	-		-	-	-
1022-1	Girl's Bathroom by Room 104 @A	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1022-2	Girl's Bathroom by Room 104 @B	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1022-3	Girl's Bathroom by Room 104 @C	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1023-1	Janitor's Closet by Room 104	SS	N/A		3/31/2020	-	-	-	Sampling Not Required	Permanent Sign Posted	-	-
1024-1	Boy's Bathroom by Room 103 @A	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-2	Boy's Bathroom by Room 103 @B	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	=
1024-3	Boy's Bathroom by Room 103 @C	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1025-1	Hallway in New Wing-Right	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1025-2	Hallway in New Wing-Right	BF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1025-3	Hallway in New Wing-Left	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1026-1	Room 135	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1026-2	Room 135	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1027-1	Room 136	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1027-2	Room 136	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1028-1	Room 137	SK	Арр	3	3/31/2020	-	-	-		-	-	-
1028-2	Room 137	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1029-1	Nurse's Office	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1029-2	Nurse's Office	BF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1029-3	Nurse's Office Bathroom	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	=
1029-4	Nurse's Office	SK	Арр	<1.0	3/31/2020	-	-	-	None	-	-	-



Laboratory Report

NYE Report #: 2201447-14349

April 3, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Floyd B Watson, Rockville Centre, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 31, 2020. New York Environmental analyzed the samples on April 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	31 Mar 2020					
Date Received:	31 Mar 2020					
Date Analyzed:	02 Apr 2020					

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K001	1	Kitchen Prep-3 Sink-SK; Initial	1.00	<1.00	μg/L	
200403K002	2	Kitchen Prep-3 Sink-SPY; Initial	1.00	<1.00	μg/L	
200403K003	3	Kitchen Hand Wash-SK; Initial	1.00	1.98	μg/L	
200403K004	4	Bathroom off of Gym & Boiler Room-SK; Initial	1.00	1.76	μg/L	
200403K005	5	Room 109-SK; Initial	1.00	2.65	μg/L	
200403K006	6	Faculty Room -SK; Initial	1.00	<1.00	μg/L	
200403K007	7	Faculty Room-SPY; Initial	1.00	<1.00	μg/L	
200403K008	8	Faculty Room Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K009	9	Room 108-SK; Initial	1.00	2.18	μg/L	
200403K010	10	Room 108-WF; Initial	1.00	1.33	μg/L	
200403K011	11	Hallway By Custodial Office/Boiler Room-WF; Initial	1.00	<1.00	μg/L	
200403K012	12	Hallway By Custodial Office/Boiler Room-BF; Initial	1.00	<1.00	μg/L	
200403K013	13	Room 107-SK; Initial	1.00	1.67	μg/L	
200403K014	14	Room 126-Guided Reading Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K015	15	Main Office Bathroom-SK; Initial	1.00	1.30	μg/L	
200403K016	16	Room 104-SK; Initial	1.00	2.12	μg/L	
200403K017	17	Room 104-WF; Initial	1.00	2.02	μg/L	
200403K018	18	Hallway by Room 103-WF; Initial	1.00	<1.00	μg/L	
200403K019	19	Room 103-SK; Initial	1.00	1.16	μg/L	
200403K020	20	Room 102-SK; Initial	1.00	<1.00	μg/L	
200403K021	21	Staff Bathroom by Room 101-SK; Initial	1.00	<1.00	μg/L	
200403K022	22	Room 110-SK; Initial	1.00	1.64	μg/L	
200403K023	23	Room 110-WF; Initial	1.00	<1.00	μg/L	
200403K024	24	Room 111-SK; Initial	1.00	<1.00	μg/L	
200403K025	25	Room 111-WF; Initial	1.00	<1.00	μg/L	
200403K026	26	Room 112-SK; Initial	1.00	<1.00	μg/L	



Date Collected:	31 Mar 2020
Date Received:	31 Mar 2020
Date Analyzed:	02 Apr 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K027	27	Room 112-WF; Initial	1.00	<1.00	μg/L	
200403K028	28	Room 113-SK; Initial	1.00	2.85	μg/L	
200403K029	29	Room 113-WF; Initial	1.00	<1.00	μg/L	
200403K030	30	Room 101-SK; Initial	1.00	<1.00	μg/L	
200403K031	31	Room 122-SK; Initial	1.00	<1.00	μg/L	
200403K032	32	Room 121-SK; Initial	1.00	1.03	μg/L	
200403K033	33	Room 121-WF; Initial	1.00	14.4	μg/L	
200403K034	34	Hallway in New Wing-Right-WF; Initial	1.00	<1.00	μg/L	
200403K035	35	Hallway in New Wing-Right-BF; Initial	1.00	<1.00	μg/L	
200403K036	36	Hallway in New Wing-Left-WF; Initial	1.00	<1.00	μg/L	
200403K037	37	Room 135-SK; Initial	1.00	<1.00	μg/L	
200403K038	38	Room 135-WF; Initial	1.00	<1.00	μg/L	
200403K039	39	Room 136-SK; Initial	1.00	<1.00	μg/L	
200403K040	40	Room 136-WF; Initial	1.00	<1.00	μg/L	
200403K041	41	Room 137-SK; Initial	1.00	3.00	μg/L	
200403K042	42	Room 137-WF; Initial	1.00	<1.00	μg/L	
200403K043	43	Nurse's Office-WF; Initial	1.00	<1.00	μg/L	
200403K044	44	Nurse's Office-BF; Initial	1.00	<1.00	μg/L	
200403K045	45	Nurse's Office-SK; Initial	1.00	<1.00	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation



Appendix B



Space #	Sample Location	Fixture Type	App or N/A	1 st Draw Results (ppb)	1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash	SK	Арр	2.37	3/31/2020	-	-	-		-	-	-
1001-2	Kitchen 3-Bay	SK	Арр	4.81	3/31/2020	-	-	-		-	-	-
1001-3	Kitchen 3-Bay	SPY	Арр	1.45	3/31/2020	-	-	-		-	-	-
1002-1	Room 1	SK	Арр	16.3	3/31/2020				Additional Sampling Required	Permanent Sign Posted		
1002-2	Room 1 Bathroom	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1003-1	Hall by Room 2	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1003-2	Hall by Room 2	BF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
1004-1	Boy's Bathroom by Room 3 @ A	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1004-2	Boy's Bathroom by Room 3 @ B	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1004-3	Boy's Bathroom Custodial Closet by Room 3	SS	N/A		3/31/2020	-	-	-		Sign Posted	-	-
1005-1	Nurse's Bathroom	SK	Арр	2.35	3/31/2020	-	-	-		-	-	-
1006-1	Nurse's Office	SK	Арр	1.95	3/31/2020	-	-	-		-	-	-
1006-2	Nurse's Office	SP	Арр	2.26	3/31/2020	-	-	-		-	-	-
1007-1	Room 6	SK	Арр	13.5	3/31/2020	-	-	-		-	-	-
1008-1	Girl's Bathroom by Room 8 @ A	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1008-2	Girl's Bathroom by Room 8 @ B	SK	Арр	2.56	3/31/2020	-	-	-		-	-	-
1009-1	Room 8 Hallway Bathroom	SK	Арр	4.11	3/31/2020	-	-	-		-	-	-
1010-1	Faculty Bathroom by Room 11	SK	Арр	1.81	3/31/2020	-	-	-		-	-	-
1011-1	Room 11 Bathroom	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1012-1	Hall by Room 11	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-



Space #	Sample Location	Fixture Type	App or N/A	1 st Draw Results (ppb)	1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-2	Hall by Room 11	BF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
2001-1	Custodial Closet by Room 28	SS	N/A		3/31/2020	-	-	-		Sign Posted	-	-
2002-1	Room 29	SK	Арр	5.05	3/31/2020	-	-	-		-	-	-
2003-1	Hall by Room 28	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
2003-2	Hall by Room 28	BF	Арр	<1.0	3/31/2020	-	-	-		-	-	-
2004-1	Girl's Bathroom by Room 28 @ A	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2004-2	Girl's Bathroom by Room 28 @ B	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2005-1	Faculty Room	SK	Арр	2.73	3/31/2020	-	-	-		-	-	-
2005-2	Faculty Room Bathroom	SK	Арр	<1.0	3/31/2020	-	-	-		-	-	-
2006-1	Boy's Bathroom by Room 21 @ A	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2006-2	Boy's Bathroom by Room 21 @ B	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2006-3	Boy's Bathroom by Room 21 @ C	SK	N/A		3/31/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2007-1	Hall by Room 21	WF	Арр	<1.0	3/31/2020	-	-	-		-	-	=
2008-1	Art Room	SK	Арр	4.96	3/31/2020	-	-	-		-	-	-
3001-1	Portable A Bathroom	SK	Арр	6.8	3/31/2020	-	-	-		-	-	-
3002-1	Portable B Bathroom	SK	Арр	6.76	3/31/2020	-	-	-		-	-	-
3002-2	Portable B Kitchen 3-Bay	SK	Арр	3.35	3/31/2020	-	-	-		-	-	-
3002-3	Portable B Kitchen Handwash	SK	Арр	2.26	3/31/2020	-	-	-		-	-	-
3003-1	Portable C Bathroom	SK	Арр	35.4	3/31/2020				Additional Sampling Required	Permanent Sign Posted		



Laboratory Report

NYE Report #: 2201450-14352

April 3, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Francis F Wilson Elementary, Rockville Centre, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on April 01, 2020. New York Environmental analyzed the samples on April 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	31 Mar 2020
Date Received:	01 Apr 2020
Date Analyzed:	02 Apr 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K162	1	Kitchen Handwash-SK; Initial	1.00	2.37	μg/L	
200403K163	2	Kitchen 3-Bay-SK; Initial	1.00	4.81	μg/L	
200403K164	3	Kitchen 3-Bay-SPY; Initial	1.00	1.45	μg/L	
200403K165	4	Room 1-SK; Initial	1.00	16.3	μg/L	Н
200403K166	5	Hall by Room 2-WF; Initial	1.00	<1.00	μg/L	
200403K167	6	Hall by Room 2-BF; Initial	1.00	<1.00	μg/L	
200403K168	7	Nurse's Bathroom-SK; Initial	1.00	2.35	μg/L	
200403K169	8	Nurse's Office-SK; Initial	1.00	1.95	μg/L	
200403K170	9	Nurse's Office-SP; Initial	1.00	2.26	μg/L	
200403K171	10	Room 6-SK; Initial	1.00	13.5	μg/L	
200403K172	11	Girl's Bathroom by Room 8 @ B-SK; Initial	1.00	2.56	μg/L	
200403K173	12	Room 8 Hallway Bathroom-SK; Initial	1.00	4.11	μg/L	
200403K174	13	Faculty Bathroom by Room 11-SK; Initial	1.00	1.81	μg/L	
200403K175	14	Hall by Room 11-WF; Initial	1.00	<1.00	μg/L	
200403K176	15	Hall by Room 11-BF; Initial	1.00	<1.00	μg/L	
200403K177	16	Room 29-SK; Initial	1.00	5.05	μg/L	
200403K178	17	Hall by Room 28-WF; Initial	1.00	<1.00	μg/L	
200403K179	18	Hall by Room 28-BF; Initial	1.00	<1.00	μg/L	
200403K180	19	Faculty Room-SK; Initial	1.00	2.73	μg/L	
200403K181	20	Faculty Room Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K182	21	Hall by Room 21-WF; Initial	1.00	<1.00	μg/L	
200403K183	22	Art Room-SK; Initial	1.00	4.96	μg/L	
200403K184	23	Portable A Bathroom-SK; Initial	1.00	6.80	μg/L	
200403K185	24	Portable B Bathroom-SK; Initial	1.00	6.76	μg/L	
200403K186	25	Portable B Kitchen 3-Bay-SK; Initial	1.00	3.35	μg/L	
200403K187	26	Portable B Kitchen Handwash-SK; Initial	1.00	2.26	μg/L	



Date Collected:	31 Mar 2020
Date Received:	01 Apr 2020
Date Analyzed:	02 Apr 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K188	27	Portable C Bathroom-SK; Initial	1.00	35.4	μg/L	Н

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix C



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Custodial Office Bathroom	SK	N/A	<1.0	9/25/2020	-	-	-		Sign Posted	-	-
1001-1	Hall by Room 11	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1002-1	Girl's Bathroom by Room 11 @ A	SK	Арр	2.05	9/25/2020	-	-	-		-	-	-
1002-2	Girl's Bathroom by Room 11 @ B	SK	Арр	6.13	9/25/2020	-	-	-		-	-	-
1003-1	Kitchen 3-Bay	SK	Арр	1.24	9/25/2020	-	-	-		-	-	-
1003-2	Kitchen 3-Bay	SK	Арр	1.61	9/25/2020	-	-	-		-	-	-
1003-3	Kitchen Handwash Sink	SK	N/A		9/25/2020	-	-	-	Sign Reqired	-	-	-
1004-1	Nurse's Isolation Room @ A	SK	Арр	1.07	9/25/2020	-	-	-		-	-	-
1004-2	Nurse's Isolation Room @ B (foot Pedal operated)	SK	Арр	19.8	9/25/2020				Additional Sampling Required	Permanent Sign Posted		
1004-3	Nurse's Isolation Room Bathroom	SK	Арр	9.74	9/25/2020	-	-	-		-	-	-
1005-1	Boy's Bathroom by Room 9 @ A	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1005-2	Boy's Bathroom by Room 9 @ B	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1006-1	Room 9	SK	Арр	1.12	9/25/2020	-	-	-		-	-	-
1007-1	Faculty Room Bathroom	SK	Арр	1.55	9/25/2020	-	-	-		-	-	-
1007-2	Faculty Room	SK	Арр	1.82	9/25/2020	-	-	-		-	-	-
1007-3	Faculty Room	IM	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1008-1	Library Bathroom	SK	Арр	1.42	9/25/2020	-	-	-		-	-	-
1009-1	Custodial Closet by Library	SS	N/A		9/25/2020	-	-	-		-	-	-
1010-1	Hall by Library	WF	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1010-2	Hall by Library	WF	Арр	<1.0	9/25/2020	-	-	-		-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-1	Main Office Bathroom	SK	Арр	3.21	9/25/2020	-	-	-		-	-	-
1012-1	Nurse's Office (new location)	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1013-1	Boy's Bathroom by Room 5 @ A	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1013-2	Boy's Bathroom by Room 5 @ B	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1014-1	Hall by Room 5	WF	Арр	2.71	9/25/2020	-	-	-		-	-	-
1015-1	Hall by Room 6	WF	Арр	3.69	9/25/2020	-	-	-		-	-	-
1016-1	Girl's Bathroom by Room 6 @ A	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
1016-2	Girl's Bathroom by Room 6 @ B	SK	Арр	1.64	9/25/2020	-	-	-		-	-	-
1017-1	Custodial Closet by Room 6	SS	N/A	2.49	9/25/2020	-	-	-		-	-	-
2001-1	Girl's Bathroom by Room 22 @ A	SK	Арр	2.49	9/25/2020	-	-	-		-	-	-
2001-2	Girl's Bathroom by Room 22 @ B	SK	Арр	2.89	9/25/2020	-	-	-		-	-	-
2002-1	Hall by Room 22	WF	Арр	1.29	9/25/2020	-	-	-		-	-	-
2003-1	Hall by Room 23	WF	Арр	<1.0	9/25/2020	-	-	-		-	-	-
2004-1	Boy's Bathroom by Room 25 @ A	SK	Арр	1.71	9/25/2020	-	-	-		-	-	-
2004-2	Boy's Bathroom by Room 25 @ B	SK	Арр	2.17	9/25/2020	-	-	-		-	-	-
2005-1	Hall by Room 29	WF	Арр		9/25/2020	-	-	-		Removed from Service	-	-
2006-1	Girl's Bathroom by Room 28 @ A	SK	Арр	1.57	9/25/2020	-	-	-		-	-	-
2006-2	Girl's Bathroom by Room 28 @ B	SK	Арр	6.01	9/25/2020	-	-	-		-	-	-
2007-1	Room 31 Bathroom	SK	Арр	2.61	9/25/2020	-	-	-		-	-	-
2008-1	Boy's Bathroom by Room 26 @ A	SK	Арр	2.22	9/25/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-2	Boy's Bathroom by Room 26 @ B	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
2009-1	Hall by Room 26	WF	Арр	1.17	9/25/2020	-	-	-		-	-	-
3001-1	Faculty Bathroom @ A	SK	Арр	<1.0	9/25/2020	-	-	-		-	-	-
3001-2	Faculty Bathroom @ B	SK	Арр	2.07	9/25/2020	-	-	-		-	-	-
3002-1	Unisex Bathroom @ A	SK	Арр	1.74	9/25/2020	-	-	-		-	-	-
3002-2	Unisex Bathroom @ B	SK	Арр	4.79	9/25/2020	-	-	-		-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-
						-	-	-	None	-	-	-



Laboratory Report

NYE Report #: 2203830-15684

September 29, 2020

Project Manager Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Jennie E. Hewitt Elementary School, Rockville Center, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on September 25, 2020. New York Environmental analyzed the samples on September 26, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	25 Sep 2020
Date Received:	25 Sep 2020
Date Analyzed:	26 Sep 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200925Q071	1	Hall by Room 11-SK; Initial	1.00	<1.00	μg/L	
200925Q072	2	Girl's Bathroom by Room 11 @ A-SK; Initial	1.00	2.05	μg/L	
200925Q073	3	Girl's Bathroom by Room 11 @ B-SK; Initial	1.00	6.13	μg/L	
200925Q074	4	Kitchen 3-Bay-SK; Initial	1.00	1.24	μg/L	
200925Q075	5	Kitchen 3-Bay-SK; Initial	1.00	1.61	μg/L	
200925Q076	6	Nurse's Isolation Room @ A-SK; Initial	1.00	1.07	μg/L	
200925Q077	7	Nurse's Isolation Room @ B (foot Pedal operated)-SK; Initial	1.00	19.8	μg/L	Н
200925Q078	8	Nurse's Isolation Room Bathroom-SK; Initial	1.00	9.74	μg/L	
200925Q079	9	Boy's Bathroom by Room 9 @ A-SK; Initial	1.00	<1.00	μg/L	
200925Q080	10	Boy's Bathroom by Room 9 @ B-SK; Initial	1.00	<1.00	μg/L	
200925Q081	11	Room 9-SK; Initial	1.00	1.12	μg/L	
200925Q082	12	Faculty Room Bathroom-SK; Initial	1.00	1.55	μg/L	
200925Q083	13	Faculty Room-SK; Initial	1.00	1.82	μg/L	
200925Q084	14	Faculty Room-IM; Initial	1.00	<1.00	μg/L	
200925Q085	15	Library Bathroom-SK; Initial	1.00	1.42	μg/L	
200925Q086	16	Hall by Library-WF; Initial	1.00	<1.00	μg/L	
200925Q087	17	Hall by Library-SPY; Initial	1.00	<1.00	μg/L	
200925Q088	18	Main Office Bathroom-SK; Initial	1.00	3.21	μg/L	
200925Q089	19	Nurse's Office (new location)-SPY; Initial	1.00	<1.00	μg/L	
200925Q090	20	Boy's Bathroom by Room 5 @ A-SK; Initial	1.00	<1.00	μg/L	
200925Q091	21	Boy's Bathroom by Room 5 @ B-SPY; Initial	1.00	<1.00	μg/L	
200925Q092	22	Hall by Room 5-WF; Initial	1.00	2.71	μg/L	
200925Q093	23	Hall by Room 6-WF; Initial	1.00	3.69	μg/L	
200925Q094	24	Girl's Bathroom by Room 6 @ A-SK; Initial	1.00	<1.00	μg/L	
200925Q095	25	Girl's Bathroom by Room 6 @ B-SK; Initial	1.00	1.64	μg/L	
200925Q096	26	Girl's Bathroom by Room 22 @ A-SK; Initial	1.00	2.49	μg/L	



Date Collected:	25 Sep 2020				
Date Received:	25 Sep 2020				
Date Analyzed:	26 Sep 2020				

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200925Q097	27	Girl's Bathroom by Room 22 @ B-SK; Initial	1.00	2.89	μg/L	
200925Q098	28	Hall by Room 22-WF; Initial	1.00	1.29	μg/L	
200925Q099	29	Hall by Room 23-WF; Initial	1.00	<1.00	μg/L	
200925Q100	30	Boy's Bathroom by Room 25 @ A-SK; Initial	1.00	1.71	μg/L	
200925Q101	31	Boy's Bathroom by Room 25 @ B-SK; Initial	1.00	2.17	μg/L	
200925Q102	32	Faculty Bathroom @ A-SK; Initial	1.00	<1.00	μg/L	
200925Q103	33	Faculty Bathroom @ B-SK; Initial	1.00	2.07	μg/L	
200925Q104	34	Unisex Bathroom @ A-SK; Initial	1.00	1.74	μg/L	
200925Q105	35	Unisex Bathroom @ B-SK; Initial	1.00	4.79	μg/L	
200925Q106	36	Girl's Bathroom by Room 28 @ A-SK; Initial	1.00	1.57	μg/L	
200925Q107	37	Girl's Bathroom by Room 28 @ B-SK; Initial	1.00	6.01	μg/L	
200925Q108	38	Room 31 Bathroom-SK; Initial	1.00	2.61	μg/L	
200925Q109	39	Boy's Bathroom by Room 26 @ A-SK; Initial	1.00	2.22	μg/L	
200925Q110	40	Boy's Bathroom by Room 26 @ B-SK; Initial	1.00	<1.00	μg/L	
200925Q111	41	Hall by Room 26-WF; Initial	1.00	1.17	μg/L	
200925Q112	42	Custodial Office Bathroom-SS; Initial	1.00	<1.00	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix D



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Prep-3 Sink	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1001-2	Kitchen Prep-3 Sink	SPY	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1001-3	Kitchen Hand Wash	SK	Арр	20.5	4/1/2020				Sign Required	Permanent Sign Posted		
1002-1	Nurse's Office Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1002-2	Nurse's Office	SK	Арр	1.06	4/1/2020	-	-	-		-	-	-
1003-1	Room 13	SK	Арр	2.18	4/1/2020	-	-	-		-	-	-
1003-2	Room 13	WF	Арр	2.95	4/1/2020	-	-	-		-	-	-
1004-1	Room 12	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1004-2	Room 12	WF	Арр	40.4	4/1/2020				Additional Sampling Required	Removed from Service Permanent Sign Posted		
1005-1	Room 11	SK	Арр	13.1	4/1/2020	-	-	-		-	-	-
1005-2	Room 11	WF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1006-1	Hallway by Gym/Vending Machines	WF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1006-2	Hallway by Gym/Vending Machines	BF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1007-1	Custodial Closet by Gym/Vending Machines	SS	N/A		4/1/2020	-	-	-	Sign Required	Permanent Sign Posted	-	-
1008-1	Boy's Bathroom by Main Office @A	SK	Арр	1.33	4/1/2020	-	-	-		-	-	-
1008-2	Boy's Bathroom by Main Office @B	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1009-1	Principle's Office Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1010-1	Main Office Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1011-1	Girl's Bathroom by Main Office @A	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1011-2	Girl's Bathroom by Main Office @B	SK	Арр	1.19	4/1/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1012-1	Room 1 Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1013-1	Room 2 Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1014-1	Room 4 Bathroom	SK	Арр	1.63	4/1/2020	-	-	-		-	-	-
1014-2	Room 4	SK	Арр	<1.0	4/1/2020	-	-	-		-		-
1014-3	Room 4	WF	Арр	<1.0	4/1/2020	-	-	-		-		-
2001-1	Second Floor Common Room/Vestibule	WF	Арр	<1.0	4/1/2020	-	-	-	-		-	-
2001-2	Second Floor Common Room/Vestibule	BF	Арр	<1.0	4/1/2020	-	-	-		-		-
2002-1	Second Floor Custodial Closet	SS	N/A		4/1/2020	-	-	-	Sign Required	Permanent Sign Posted	-	-
0001-1	Professional Development Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
0001-2	Professional Development Kitchen	SK	Арр	2.3	4/1/2020	-	-	-		-	-	-
0002-1	Hallway by PDC Kitchen	IM	Арр	<1.0	4/1/2020	-	-	-		-	-	-
0003-1	Boiler Room	SS	N/A		4/1/2020	-	-	-	Sign Required	Permanent Sign Posted	-	-
0004-1	Faculty Bathroom by Art/Music Room	SK	Арр	1.44	4/1/2020	-	-	-		-	-	-
0005-1	Art/Music Room	SK	Арр	5.63	4/1/2020	-	-	-	_		-	-
0006-1	Faculty Room	SK	Арр	1.17	4/1/2020	-	-	-		-	-	-
0006-2	Faculty Room	IM	Арр		4/1/2020	-	-	-		Removed from Service	-	-



Laboratory Report

NYE Report #: 2201449-14351

April 3, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Riverside Elementary

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on April 03, 2020. New York Environmental analyzed the samples on April 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	01 Apr 2020			
Date Received:	03 Apr 2020			
Date Analyzed:	02 Apr 2020			

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K130	1	Kitchen Prep-3 Sink-SK; Initial	1.00	<1.00	μg/L	
200403K131	2	Kitchen Prep-3 Sink-SPY; Initial	1.00	<1.00	μg/L	
200403K132	3	Kitchen Hand Wash-SK; Initial	1.00	20.5	μg/L	Н
200403K133	4	Nurse's Office Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K134	5	Nurse's Office-SK; Initial	1.00	1.06	μg/L	
200403K135	6	Room 13-SK; Initial	1.00	2.18	μg/L	
200403K136	7	Room 13-WF; Initial	1.00	2.95	μg/L	
200403K137	8	Room 12-SK; Initial	1.00	<1.00	μg/L	
200403K138	9	Room 12-WF; Initial	1.00	40.4	μg/L	Н
200403K139	10	Room 11-SK; Initial	1.00	13.1	μg/L	
200403K140	11	Room 11-WF; Initial	1.00	<1.00	μg/L	
200403K141	12	Hallway by Gym/Vending Machines-WF; Initial	1.00	<1.00	μg/L	
200403K142	13	Hallway by Gym/Vending Machines-BF; Initial	1.00	<1.00	μg/L	
200403K143	14	Boy's Bathroom by Main Office @A-SK; Initial	1.00	1.33	μg/L	
200403K144	15	Boy's Bathroom by Main Office @B-SK; Initial	1.00	<1.00	μg/L	
200403K145	16	Principle's Office Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K146	17	Main Office Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K147	18	Girl's Bathroom by Main Office @A-SK; Initial	1.00	<1.00	μg/L	
200403K148	19	Girl's Bathroom by Main Office @B-SK; Initial	1.00	1.19	μg/L	
200403K149	20	Room 1 Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K150	21	Room 2 Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K151	22	Room 4 Bathroom-SK; Initial	1.00	1.63	μg/L	
200403K152	23	Room 4-SK; Initial	1.00	<1.00	μg/L	
200403K153	24	Room 4-WF; Initial	1.00	<1.00	μg/L	
200403K154	25	Second Floor Common Room/Vestibule-WF; Initial	1.00	<1.00	μg/L	
200403K155	26	Second Floor Common Room/Vestibule-BF; Initial	1.00	<1.00	μg/L	



Date Collected:	01 Apr 2020
Date Received:	03 Apr 2020
Date Analyzed:	02 Apr 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K156	27	Professional Development Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K157	28	Professional Development Kitchen-SK; Initial	1.00	2.30	μg/L	
200403K158	29	Hallway by PDC Kitchen-IM; Initial	1.00	<1.00	μg/L	
200403K159	30	Faculty Bathroom by Art/Music Room-SK; Initial	1.00	1.44	μg/L	
200403K160	31	Art/Music Room-SK; Initial	1.00	5.63	μg/L	
200403K161	32	Faculty Room-SK; Initial	1.00	1.17	μg/L	

CID: Client ID LOQ: Limit of Quantitation



Appendix E



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Prep	SK	Арр	1.78	4/1/2020	-	-	-		-	-	-
1001-2	Kitchen Prep	SPY	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1001-3	Kitchen Handwash	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1002-1	Room 121 Bathroom	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1003-1	Room 122 Bathroom	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1004-1	Room 124 Bathroom	SK	Арр	1.77	4/1/2020	-	-	-		-	-	-
1005-1	Room 125 Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1006-1	Room 126	WF	Арр	1.44	4/1/2020	-	-	-		-	-	-
1006-2	Room 126	SK	Арр	10.4	4/1/2020	-	-	-		-	-	-
1007-1	Room 128	SK	Арр	1.89	4/1/2020	-	-	-		-	-	-
1008-1	Custodial Closet by Room 128	SS	N/A		4/1/2020	-	-	-	Sampling Not Required	-	-	-
1009-1	Hallway by Lobby Area	WF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1010-1	Student Bathroom Lobby Area	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1011-1	Faculty Bathroom Lobby Area	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1012-1	ADA Bathroom Lobby Area	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1013-1	Room 200 Counter @ A (Left)	SK	Арр	9.87	4/1/2020	-	-	-		-	-	-
1013-2	Room 200 Counter @ B (Right)	SK	Арр	12.9	4/1/2020	-	-	-		-	-	-
1014-1	Room 103	SK	Арр	1.98	4/1/2020	-	-	-		-	-	-
1014-2	Room 103 Bathroom	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1015-1	Room 104	SK	Арр	5.86	4/1/2020	-	-	-		-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1016-1	Hallway by Room 105	WF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1016-2	Hallway by Room 105	BF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1017-1	Room 106 Bathroom	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1018-1	Faculty Lounge Room 108	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1018-2	Faculty Lounge Room 108 Bathroom	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1019-1	Hallway by Room 109	WF	Арр	2.33	4/1/2020	-	-	-		-	-	-
1020-1	Room 109	SK	Арр	35.2	4/1/2020				Additional Sampling Required	Permanent Sign Posted		
1020-2	Room 109 Bathroom	SK	Арр	3.45	4/1/2020	-	-	-		-	-	-
1021-1	Room 110	SK	Арр	4.09	4/1/2020	-	-	-		-	-	-
1022-1	Room 111	SK	Арр	15.5	4/1/2020				Additional Sampling Required	Permanent Sign Posted		
1023-1	Room 112	SK	Арр	11.8	4/1/2020	-	-	-		-	-	-
1024-1	Room 113	SK	Арр	3.09	4/1/2020	-	-	-		-	-	-
1025-1	Room 114	SK	Арр	12.1	4/1/2020	-	-	-		-	-	-
1026-1	Room 115	SK	Арр	15.3	4/1/2020				Additional Sampling Requried	Permanent Sign Posted		
1027-1	Hallway by Room 116 (Right)	WF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1027-2	Hallway by Room 116 (Left)	WF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1028-1	Room 116	SK	Арр	15.4	4/1/2020				Additional Sampling Required	Permanent Sign Posted		
1029-1	Girls Bathroom by Room 111 @ A	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1029-2	Girls Bathroom by Room 111 @ B	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1029-3	Girls Bathroom by Room 111 @ C	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1029-4	Girls Bathroom by Room 111 @ D	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1029-5	Girls Bathroom by Room 111 @ E	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1030-1	Custodial Closet by Room 111	SS	N/A		4/1/2020	-	-	-	Sampling Not Required	-	-	-
1031-1	Boys Bathroom by Room 110 @ A	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1031-2	Boys Bathroom by Room 110 @ B	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1031-3	Boys Bathroom by Room 110 @ C	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1031-4	Boys Bathroom by Room 110 @ D	SK	N/A		4/1/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1032-1	Boiler Room Bathroom	SK	Арр	3.64	4/1/2020	-	-	-		-	-	-
1033-1	Gym Vestibule by Nurses Office	WF	Арр	1.13	4/1/2020	-	-	-		-	-	-
1034-1	Nurses Office	SK	Арр	1.6	4/1/2020	-	-	-		-	-	-
1034-2	Nurses Office	BF	Арр	<1.0	4/1/2020	-	-	-		-	-	-
1034-3	Nurses Office Bathroom	SK	Арр	<1.0	4/1/2020	-	-	-		-	-	-



Laboratory Report

NYE Report #: 2201452-14354

April 3, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: William S Covert Elementary, Rockville Centre, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on April 01, 2020. New York Environmental analyzed the samples on April 02, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	01 Apr 2020
Date Received:	01 Apr 2020
Date Analyzed:	02 Apr 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K252	1	Kitchen Prep-SK; Initial	1.00	1.78	μg/L	
200403K253	2	Kitchen Prep-SPY; Initial	1.00	<1.00	μg/L	
200403K254	3	Kitchen Handwash-SK; Initial	1.00	<1.00	μg/L	
200403K255	4	Room 124 Bathroom-SK; Initial	1.00	1.77	μg/L	
200403K256	5	Room 125 Bathroom-SK; Initial	1.00	<1.00	μg/L	
200403K257	6	Room 126-WF; Initial	1.00	1.44	μg/L	
200403K258	7	Room 126-SK; Initial	1.00	10.4	μg/L	
200403K259	8	Room 128-SK; Initial	1.00	1.89	μg/L	
200403K260	9	Hallway by Lobby Area-WF; Initial	1.00	<1.00	μg/L	
200403K261	10	ADA Bathroom Lobby Area-SK; Initial	1.00	<1.00	μg/L	
200403K262	11	Room 200 Counter @ A (Left)-SK; Initial	1.00	9.87	μg/L	
200403K263	12	Room 200 Counter @ B (Right)-SK; Initial	1.00	12.9	μg/L	
200403K264	13	Room 103-SK; Initial	1.00	1.98	μg/L	
200403K265	14	Room 104-SK; Initial	1.00	5.86	μg/L	
200403K266	15	Hallway by Room 105-WF; Initial	1.00	<1.00	μg/L	
200403K267	16	Hallway by Room 105-BF; Initial	1.00	<1.00	μg/L	
200403K268	17	Faculty Lounge Room 108-SK; Initial	1.00	<1.00	μg/L	
200403K269	18	Hallway by Room 109-WF; Initial	1.00	2.33	μg/L	
200403K270	19	Room 109-SK; Initial	1.00	35.2	μg/L	Н
200403K271	20	Room 109 Bathroom-SK; Initial	1.00	3.45	μg/L	
200403K272	21	Room 110-SK; Initial	1.00	4.09	μg/L	
200403K273	22	Room 111-SK; Initial	1.00	15.5	μg/L	Н
200403K274	23	Room 112-SK; Initial	1.00	11.8	μg/L	
200403K275	24	Room 113-SK; Initial	1.00	3.09	μg/L	
200403K276	25	Room 114-SK; Initial	1.00	12.1	μg/L	
200403K277	26	Room 115-SK; Initial	1.00	15.3	μg/L	Н



Date Collected:	01 Apr 2020
Date Received:	01 Apr 2020
Date Analyzed:	02 Apr 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200403K278	27	Hallway by Room 116 (Right)-WF; Initial	1.00	<1.00	μg/L	
200403K279	28	Hallway by Room 116 (Left)-WF; Initial	1.00	<1.00	μg/L	
200403K280	29	Room 116-SK; Initial	1.00	15.4	μg/L	Н
200403K281	30	Boiler Room Bathroom-SK; Initial	1.00	3.64	μg/L	
200403K282	31	Gym Vestibule by Nurses Office-WF; Initial	1.00	1.13	μg/L	
200403K283	32	Nurses Office-SK; Initial	1.00	1.60	μg/L	
200403K284	33	Nurses Office-BF; Initial	1.00	<1.00	μg/L	
200403K285	34	Nurses Office Bathroom-SK; Initial	1.00	<1.00	μg/L	

CID: Client ID LOQ: Limit of Quantitation



Appendix F



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
0001-1	Basement Hall	SK	Арр	2.89	3/27/2020						-	-
0002-1	Basement Faculty Room Bathroom	SK	Арр	<1.0	3/27/2020						-	_
0002-2	Basement Faculty Room	SK	Арр	<1.0	3/27/2020						-	_
0002-3	Basement Faculty Room	SK	Арр	<1.0	3/27/2020						_	_
1001-1	Boy's Locker Room Bathroom @ A	SK	Арр	9.78	3/27/2020					Sign Posted	-	_
1001-2	Boy's Locker Room Bathroom @ B	SK	Арр	<1.0	3/27/2020					Sign Posted	-	-
1001-3	Boy's Locker Room Bathroom @ C	SK	Арр	2.44	3/27/2020					Sign Posted	-	-
1002-1	Hall by Boy's Locker Room	WF	Арр	<1.0	3/27/2020						-	-
1003-1	Hall by Room 119	WF	Арр	<1.0	3/27/2020						-	-
1003-2	Hall by Room 119	BF	Арр	<1.0	3/27/2020						-	-
1004-1	Room 122	SK	Арр	<1.0	3/27/2020						-	-
1005-1	Girl's Locker Room Bathroom @ A	SK	Арр	1.43	3/27/2020					Sign Posted	-	-
1005-2	Girl's Locker Room Bathroom @ B	SK	Арр	<1.0	3/27/2020					Sign Posted	-	-
1006-1	Room 124	SK	Арр	<1.0	3/27/2020					Sign Posted	-	-
1007-1	Room 126	SK	Арр	2.81	3/27/2020					Sign Posted	-	-
1008-1	Room 128	SK	Арр	<1.0	3/27/2020					Sign Posted	-	-
1009-1	Room 116 Unit 1 @ A	SK	Арр	33.4	3/27/2020				Sign Required	Permanent Sign Posted		
1009-2	Room 116 Unit 1 @ B	SK	Арр	2.92	3/27/2020						-	-
1009-3	Room 116 Unit 2 @ A	SK	Арр	1.45	3/27/2020						-	-
1009-4	Room 116 Unit 2 @ B	SK	Арр	<1.0	3/27/2020						-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-1	Hall by Room 102	WF	Арр	1.54	3/27/2020						-	-
1011-1	Room 102 Bathroom	SK	Арр	1.98	3/27/2020						-	-
1012-1	Nurse's Office	SK	Арр	<1.0	3/27/2020						-	-
1012-2	Nurse's Office Bathroom	SK	Арр	1.69	3/27/2020						-	-
1013-1	Hall by Nurse's Office	WF	Арр	<1.0	3/27/2020						-	-
1014-1	Girl's Bathroom by Auditorium	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1014-2	Girl's Bathroom ADA by Auditorium	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1015-1	Faculty Bathroom by Auditorium	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1016-1	Principal's Office Bathroom	SK	Арр	2.95	3/27/2020						-	-
1017-1	Hall by Principal's Office	WF	Арр	<1.0	3/27/2020						-	-
1017-2	Hall by Principal's Office	BF	Арр	<1.0	3/27/2020						-	-
1018-1	Boy's Bathroom by Principal's Office @ A	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1018-2	Boy's Bathroom by Principal's Office @ B	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1019-1	Room 115	SK	Арр	1.77	3/27/2020						-	-
1020-1	Custodial Closet by Room 115	SS	N/A	1.34	3/27/2020					Sign Posted	-	-
1021-1	Room 121	SK	Арр	1.34	3/27/2020						-	-
1022-1	Time Clock Room Bathroom	SK	Арр	<1.0	3/27/2020						-	-
1023-1	Custodial Closet by Room 116	SS	N/A	<1.0	3/27/2020					Sign Posted	-	-
2001-1	Faculty Bathroom by Room 216	SK	N/A	2.99	3/27/2020						-	-
2002-1	Hall by Room 216	WF	Арр	2.9	3/27/2020						-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-1	Girl's Coach's Bathroom	SK	Арр	5.17	3/27/2020						-	-
2004-1	Boy's Coach's Bathroom	SK	Арр		3/27/2020					Removed from Service	-	-
2005-1	Room 224 Unit 1 @ A	SK	Арр	2.9	3/27/2020					Sign Posted	-	-
2005-2	Room 224 Unit 1 @ B	SK	Арр	5.17	3/27/2020					Sign Posted	-	-
2005-3	Room 224 Unit 2 @ A	SK	Арр	2.12	3/27/2020					Sign Posted	-	-
2005-4	Room 224 Unit 2 @ B	SK	Арр	5.57	3/27/2020					Sign Posted	-	-
2006-1	Hall by Main Gym	WF	Арр	<1.0	3/27/2020						-	-
2006-2	Hall by Main Gym	BF	Арр	<1.0	3/27/2020						-	-
2007-1	Kitchen Prep	SK	Арр	1.83	3/27/2020						-	-
2007-2	Kitchen 3-Bay @ A	SK	Арр	8.66	3/27/2020						-	-
2007-3	Kitchen 3-Bay @ A	SPY	Арр	2.97	3/27/2020						-	-
2007-4	Kitchen 3-Bay @ B	SK	Арр	2.66	3/27/2020						-	-
2007-5	Kitchen 3-Bay @ C	SK	Арр	2.03	3/27/2020						-	-
2007-6	Kitchen 3-Bay @ D	SK	Арр	2.1	3/27/2020						-	-
2007-7	Kitchen Ice Machine	SK	Арр	<1.0	3/27/2020						-	-
2007-8	Kitchen Warewashing	SK	Арр	13.4	3/27/2020						-	-
2007-9	Kitchen Warewashing	SPY	N/A		3/27/2020						-	-
2007-10	Kitchen Handwash by Warewashing	SK	Арр	<1.0	3/27/2020						-	-
2007-11	Kitchen Island	SK	Арр	3.34	3/27/2020						-	-
2008-1	Faculty Room	SK	Арр	3.24	3/27/2020						-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-2	Faculty Room	SP	Арр	<1.0	3/27/2020						-	-
2009-1	Custodial Closet by Faculty Room	SS	N/A		3/27/2020					Sign Posted	-	-
2010-1	Faculty Bathroom by Kitchen	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2011-1	Room 207 Station 1	SK	Арр	3.83	3/27/2020						-	-
2011-2	Room 207 Station 2	SK	Арр	1.85	3/27/2020						-	-
2011-3	Room 207 Station 3	SK	Арр	2.43	3/27/2020						-	-
2011-4	Room 207 Station 4	SK	Арр	1.48	3/27/2020						-	-
2012-1	Hall by Room 223	WF	Арр	<1.0	3/27/2020						-	-
2013-1	Boy's Bathroom by Room 223 @ A	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2013-2	Boy's Bathroom by Room 223 @ B	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2014-1	Room 202B	SK	Арр	8.88	3/27/2020					Sign Posted	-	-
2015-1	Faculty Bathroom by Room 202	SK	Арр	<1.0	3/27/2020						-	-
2016-1	Girl's Bathroom by Room 206 @ A	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2016-2	Girl's Bathroom by Room 206 @ B	SK	N/A		3/27/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2017-1	Hall by Room 204	WF	Арр	<1.0	3/27/2020						-	-
3001-1	Room 308 Teacher's Station	SK	Арр	23.9	3/27/2020					Permanent Sign Posted		
3001-2	Room 308 Counter 1	SK	Арр	11	3/27/2020						-	-
3001-3	Room 308 Counter 2 @ A	SK	N/A		3/27/2020					Removed from Service	-	-
3001-4	Room 308 Counter 2 @ B	SK	N/A		3/27/2020					Removed from Service	-	-
3001-5	Room 308 Counter 3	SK	Арр	35.9	3/27/2020					Permanent Sign Posted		

Space#	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3001-6	Room 308 Counter 4 @ A	SK	N/A		3/27/2020					Removed from Service	-	-
3001-7	Room 308 Counter 4 @ B	SK	N/A		3/27/2020					Removed from Service	-	-
3002-1	Room 309 Teacher's Station	SK	Арр	17.5	3/27/2020					Sign Posted		
3002-2	Room 309 Counter 1	SK	Арр	14.8	3/27/2020					Sign Posted	-	-
3002-3	Room 309 Counter 2	SK	Арр	81.8	3/27/2020					Sign Posted		
3002-4	Room 309 Counter 3 @ A	SK	Арр		3/27/2020					Removed from Service	-	-
3002-5	Room 309 Counter 3 @ B	SK	Арр	15.5	3/27/2020					Sign Posted		
3002-6	Room 309 Counter 3 @ C	SK	Арр	43.8	3/27/2020					Sign Posted		
3002-7	Room 309 Counter 3 @ D	SK	Арр	73.7	3/27/2020					Sign Posted		
3003-1	Room 307 Teacher's Station	SK	Арр	35.4	3/27/2020					Sign Posted		
3003-2	Room 307 Counter 1	SK	Арр	321	3/27/2020					Sign Posted		
3003-3	Room 307 Counter 2	SK	Арр	24.1	3/27/2020					Sign Posted		
3004-1	Room 305 Teacher's Station	SK	Арр		3/27/2020					Removed from Service	-	-
3004-2	Room 305 Counter 1 @ A	SK	Арр	11.8	3/27/2020					Sign Posted	-	-
3004-3	Room 305 Counter 1 @ B	SK	Арр	23.4	3/27/2020					Sign Posted		
3004-4	Room 305 Counter 1 @ C	SK	Арр		3/27/2020	-	-	-	None	Removed from Service	-	-
3004-5	Room 305 Counter 1 @ D	SK	Арр	60.1	3/27/2020					Sign Posted		
3004-6	Room 305 Counter 2	SK	Арр	13.2	3/27/2020	-	-	-	None	-	-	-
3005-1	Room 303 Teacher's Station	SK	Арр	9.8	3/27/2020	-	-	-	None	-	-	-
3005-2	Room 303 Counter	SK	Арр	4.61	3/27/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
3006-1	Hall by Room 301	WF	Арр	<1.0	3/27/2020	-	-	-	None	-	-	-
3006-2	Hall by Room 301	BF	Арр	<1.0	3/27/2020	-	-	-	None	-	-	-
3007-1	Faculty Bathroom by Room 316 @ A	SK	Арр	<1.0	3/27/2020	-	-	-	None	-	-	-
3007-2	Faculty Bathroom by Room 316 @ B	SK	Арр	5.92	3/27/2020	-	-	-	None	-	-	-
3008-1	Hall by Room 312	SK	Арр	1.04	3/27/2020	-	-	-	None	-	-	-
3009-1	Room 402 Unit @ A	SK	Арр	8.63	3/27/2020	-	-	-	None	-	-	-
3009-2	Room 402 Unit @ B	SK	Арр	8.94	3/27/2020	-	-	-	None	-	-	-



Laboratory Report

NYE Report #: 2201416-14322

March 31, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: South Side Middle School, Rockville Centre, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 27, 2020. New York Environmental analyzed the samples on March 28, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	27 Mar 2020
Date Collected.	21 IVIAI 2020
Date Received:	27 Mar 2020
Date Analyzed:	28 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200330L001	1	Boy's Locker Room Bathroom @ A-SK; Initial	1.00	9.78	μg/L	
200330L002	2	Boy's Locker Room Bathroom @ B-SK; Initial	1.00	<1.00	μg/L	
200330L003	3	Boy's Locker Room Bathroom @ C-SK; Initial	1.00	2.44	μg/L	
200330L004	4	Hall by Boy's Locker Room-WF; Initial	1.00	<1.00	μg/L	
200330L005	5	Hall by Room 119-WF; Initial	1.00	<1.00	μg/L	
200330L006	6	Hall by Room 119-BF; Initial	1.00	<1.00	μg/L	
200330L007	7	Room 122-SK; Initial	1.00	<1.00	μg/L	
200330L008	8	Girl's Locker Room Bathroom @ A-SK; Initial	1.00	1.43	μg/L	
200330L009	9	Girl's Locker Room Bathroom @ B-SK; Initial	1.00	<1.00	μg/L	
200330L010	10	Room 124-SK; Initial	1.00	<1.00	μg/L	
200330L011	11	Room 126-SK; Initial	1.00	2.81	μg/L	
200330L012	12	Room 128-SK; Initial	1.00	<1.00	μg/L	
200330L013	13	Room 116 Unit 1 @ A-SK; Initial	1.00	33.4	μg/L	Н
200330L014	14	Room 116 Unit 1 @ B-SK; Initial	1.00	2.92	μg/L	
200330L015	15	Room 116 Unit 2 @ A-SK; Initial	1.00	1.45	μg/L	
200330L016	16	Room 116 Unit 2 @ B-SK; Initial	1.00	<1.00	μg/L	
200330L017	17	Hall by Room 102-WF; Initial	1.00	1.54	μg/L	
200330L018	18	Room 102 Bathroom-SK; Initial	1.00	1.98	μg/L	
200330L019	19	Nurse's Office-SK; Initial	1.00	<1.00	μg/L	
200330L020	20	Nurse's Office Bathroom-SK; Initial	1.00	1.69	μg/L	
200330L021	21	Hall by Nurse's Office-WF; Initial	1.00	<1.00	μg/L	
200330L022	22	Principal's Office Bathroom-SK; Initial	1.00	2.95	μg/L	
200330L023	23	Hall by Principal's Office-WF; Initial	1.00	<1.00	μg/L	
200330L024	24	Hall by Principal's Office-BF; Initial	1.00	<1.00	μg/L	
200330L025	25	Room 115-SK; Initial	1.00	1.77	μg/L	
200330L026	26	Room 121-SK; Initial	1.00	1.34	μg/L	



Date Collected:	27 Mar 2020
Date Received:	27 Mar 2020
Date Analyzed:	28 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200330L027	27	Time Clock Room Bathroom-SK; Initial	1.00	<1.00	μg/L	
200330L028	28	Hall by Room 216-WF; Initial	1.00	<1.00	μg/L	
200330L029	29	Girl's Coach's Bathroom-SK; Initial	1.00	2.99	μg/L	
200330L030	30	Room 224 Unit 1 @ A-SK; Initial	1.00	2.90	μg/L	
200330L031	31	Room 224 Unit 1 @ B-SK; Initial	1.00	5.17	μg/L	
200330L032	32	Room 224 Unit 2 @ A-SK; Initial	1.00	2.12	μg/L	
200330L033	33	Room 224 Unit 2 @ B-SK; Initial	1.00	5.57	μg/L	
200330L034	34	Hall by Main Gym-WF; Initial	1.00	<1.00	μg/L	
200330L035	35	Hall by Main Gym-BF; Initial	1.00	<1.00	μg/L	
200330L036	36	Kitchen Prep-SK; Initial	1.00	1.83	μg/L	
200330L037	37	Kitchen 3-Bay @ A-SK; Initial	1.00	8.66	μg/L	
200330L038	38	Kitchen 3-Bay @ A-SPY; Initial	1.00	2.97	μg/L	
200330L039	39	Kitchen 3-Bay @ B-SK; Initial	1.00	2.66	μg/L	
200330L040	40	Kitchen 3-Bay @ C-SK; Initial	1.00	2.03	μg/L	
200330L041	41	Kitchen 3-Bay @ D-SK; Initial	1.00	2.10	μg/L	
200330L042	42	Kitchen Ice Machine-SK; Initial	1.00	<1.00	μg/L	
200330L043	43	Kitchen Warewashing-SK; Initial	1.00	13.4	μg/L	
200330L044	44	Kitchen Handwash by Warewashing-SK; Initial	1.00	<1.00	μg/L	
200330L045	45	Kitchen Island-SK; Initial	1.00	3.34	μg/L	
200330L046	46	Faculty Room-SK; Initial	1.00	3.24	μg/L	
200330L047	47	Faculty Room-SP; Initial	1.00	<1.00	μg/L	
200330L048	48	Room 207 Station 1-SK; Initial	1.00	3.83	μg/L	
200330L049	49	Room 207 Station 2-SK; Initial	1.00	1.85	μg/L	
200330L050	50	Room 207 Station 3-SK; Initial	1.00	2.43	μg/L	
200330L051	51	Room 207 Station 4-SK; Initial	1.00	1.48	μg/L	
200330L052	52	Hall by Room 223-WF; Initial	1.00	<1.00	μg/L	
200330L053	53	Room 202B-SK; Initial	1.00	8.88	μg/L	



Date Collected:	27 Mar 2020
Date Received:	27 Mar 2020
Date Analyzed:	28 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200330L054	54	Faculty Bathroom by Room 202-SK; Initial	1.00	<1.00	μg/L	
200330L055	55	Hall by Room 204-WF; Initial	1.00	<1.00	μg/L	
200330L056	56	Room 308 Teacher's Station-SK; Initial	1.00	23.9	μg/L	Н
200330L057	57	Room 308 Counter 1-SK; Initial	1.00	11.0	μg/L	
200330L058	58	Room 308 Counter 3-SK; Initial	1.00	35.9	μg/L	Н
200330L059	59	Room 309 Teacher's Station-SK; Initial	1.00	17.5	μg/L	Н
200330L060	60	Room 309 Counter 1-SK; Initial	1.00	14.8	μg/L	
200330L061	61	Room 309 Counter 2-SK; Initial	1.00	81.8	μg/L	E,H
200330L062	62	Room 309 Counter 3 @ B-SK; Initial	1.00	15.5	μg/L	Н
200330L063	63	Room 309 Counter 3 @ C-SK; Initial	1.00	43.8	μg/L	Н
200330L064	64	Room 309 Counter 3 @ D-SK; Initial	1.00	73.7	μg/L	E,H
200330L065	65	Room 307 Teacher's Station-SK; Initial	1.00	35.4	μg/L	Н
200330L066	66	Room 307 Counter 1-SK; Initial	1.00	321	μg/L	E,H
200330L067	67	Room 307 Counter 2-SK; Initial	1.00	24.1	μg/L	Н
200330L068	68	Room 305 Counter 1 @ A-SK; Initial	1.00	11.8	μg/L	
200330L069	69	Room 305 Counter 1 @ B-SK; Initial	1.00	23.4	μg/L	Н
200330L070	70	Room 305 Counter 1 @ D-SK; Initial	1.00	60.1	μg/L	E,H
200330L071	71	Room 305 Counter 2-SK; Initial	1.00	13.6	μg/L	
200330L072	72	Room 303 Teacher's Station-SK; Initial	1.00	9.80	μg/L	
200330L073	73	Room 303 Counter-SK; Initial	1.00	4.61	μg/L	
200330L074	74	Hall by Room 301-WF; Initial	1.00	<1.00	μg/L	
200330L075	75	Hall by Room 301-BF; Initial	1.00	<1.00	μg/L	
200330L076	76	Faculty Bathroom by Room 316 @ A-SK; Initial	1.00	<1.00	μg/L	
200330L077	77	Faculty Bathroom by Room 316 @ B-SK; Initial	1.00	5.92	μg/L	
200330L078	78	Hall by Room 312-SK; Initial	1.00	1.04	μg/L	
200330L079	79	Room 402 Unit @ A-SK; Initial	1.00	8.63	μg/L	
200330L080	80	Room 402 Unit @ B-SK; Initial	1.00	8.94	μg/L	



Date Collected:	27 Mar 2020
Date Received:	27 Mar 2020
Date Analyzed:	28 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200330L081	81	Basement Hall-SK; Initial	1.00	2.89	μg/L	
200330L082	82	Basement Faculty Room Bathroom-SK; Initial	1.00	<1.00	μg/L	
200330L083	83	Basement Faculty Room -SK; Initial	1.00	<1.00	μg/L	
200330L084	84	Basement Faculty Room -SPY; Initial	1.00	<1.00	μg/L	

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.



Appendix G



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash by Fridge	SK	Арр	1.2	3/26/2020						-	-
1001-2	Kitchen lce Machine	IM	Арр	<1.0	3/26/2020						-	-
1001-3	Kitchen Handwash by Ice Machine	SK	Арр	4.51	3/26/2020						-	-
1001-4	Kitchen 2-Bay @ A	SK	Арр	1.49	3/26/2020						-	-
1001-5	Kitchen 2-Bay @ B	SK	Арр	<1.0	3/26/2020						-	-
1001-6	Kitchen Bathroom	SK	Арр	5.11	3/26/2020						-	-
1001-7	Kitchen 3-Bay @ A	SK	Арр	<1.0	3/26/2020						-	-
1001-8	Kitchen 3-Bay @ A	SPY	Арр	<1.0	3/26/2020						-	-
1001-9	Kitchen 3-Bay @ B	SK	Арр	1.46	3/26/2020						-	-
1001-10	Kitchen Handwash by Bathroom	SK	Арр	<1.0	3/26/2020						-	-
1001-11	Kitchen Island	SK	Арр	2.07	3/26/2020						-	-
1001-12	Kitchen handwash by Ice Cream Maker	SK	Арр	2.14	3/26/2020						-	-
1001-13	Kitchen Serving Line Bain Marie @ A	SP	Арр	1.03	3/26/2020						-	-
1001-14	Kitchen Serving Line Bain Marie @ D	SP	Арр	1.95	3/26/2020						-	-
1002-1	Main Office Women's Bathroom	SK	Арр	1.89	3/26/2020						-	-
1003-1	Main Office Men's Bathroom	SK	Арр	1.13	3/26/2020						-	-
1004-1	Hall by Main Office	SK	Арр	2.54	3/26/2020						-	-
1005-1	Lobby Men's Faculty Bathroom	SK	Арр	5.53	3/26/2020						-	-
1006-1	Lobby Women's Faculty Bathroom @A	SK	Арр	1.44	3/26/2020						-	-
1006-2	Lobby Women's Faculty Bathroom @B	SK	Арр	4.35	3/26/2020						-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-1	Custodial Closet 1207C	SS	N/A		3/26/2020					Sign Posted	-	-
1008-1	Room 1203 Music	WF	Арр	<1.0	3/26/2020						-	-
1008-2	Room 1203 Music	BF	Арр	<1.0	3/26/2020						-	-
1008-3	Room 1203 Music	SK	Арр	<1.0	3/26/2020						-	-
1008-4	Room 1203 Music Bathroom -Right	SK	Арр	3	3/26/2020						-	-
1008-5	Room 1203 Music Bathroom-Left	SK	Арр	<1.0	3/26/2020						-	-
1009-1	Hall by 1203	WF	Арр	7.34	3/26/2020						-	-
1010-1	Hall by 1109 Bathroom-left	WF	Арр	<1.0	3/26/2020						-	-
1010-2	Hall by 1109 Bathroom	WF	Арр	<1.0	3/26/2020						-	-
1010-3	Hall by 1109 Bathroom	BF	Арр	<1.0	3/26/2020						-	-
1011-1	Girl's Bathroom by Room 1109 @ A	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1011-2	Girl's Bathroom by Room 1109 @ B	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1012-1	Boy's Bathroom by Room 1111 @ A	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1012-2	Boy's Bathroom by Room 1111 @ B	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1013-1	Fitness Room 1107-right	WF	Арр	<1.0	3/26/2020						-	-
1013-2	Fitness Room 1107-left	WF	Арр	<1.0	3/26/2020						-	-
1013-3	Fitness Room 1107-left	BF	Арр	<1.0	3/26/2020						-	-
1014-1	Gender Neutral Bathroom in 1107	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1015-1	Custodial Closet 1107C	SS	N/A		3/26/2020					Sign Posted	-	-
1016-1	Girl's Locker Room Coach's Bathroom	SK	Арр	1.34	3/26/2020						-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1016-2	Girl's Locker Room	WF	Арр	6.54	3/26/2020						-	-
1016-3	Girl's Locker Room Custodial Closet	SS	N/A		3/26/2020					Sign Posted	-	-
1016-4	Girl's Locker Room Bathroom @ A	SK	Арр	1.49	3/26/2020						-	-
1016-5	Girl's Locker Room Bathroom @ B	SK	Арр	2.34	3/26/2020						-	-
1016-6	Girl's Locker Room Ice Machine	IM	Арр	<1.0	3/26/2020						-	-
1017-1	Hall by Room 1303	WF	Арр	1.38	3/26/2020						-	-
1018-1	Boy's Locker Room Coach's Bathroom	SK	Арр	30.2	3/26/2020					Permanent Sign Posted		
1018-2	Boy's Locker Room Custodial Closet	SS	N/A		3/26/2020					Sign Posted	-	-
1018-3	Boy's Locker Room Bathroom @ A	SK	Арр	2.9	3/26/2020						-	-
1018-4	Boy's Locker Room Bathroom @ B	SK	Арр	1.41	3/26/2020						-	-
1018-5	Boy's Locker Room Bathroom @ C	SK	Арр	10.9	3/26/2020						-	-
1018-6	Boy's Locker Room	WF	Арр	1.91	3/26/2020						-	-
1019-1	Boiler Room Bathroom	SK	Арр	1.06	3/26/2020						-	-
1020-1	Nurse's Office Bathroom	SK	Арр	2.54	3/26/2020						-	-
1020-2	Nurse's Office Exam Room	SK	Арр	10.7	3/26/2020						-	-
1021-1	Girl's Bathroom 1313 @ A	SK	Арр	2.11	3/26/2020						-	-
1021-2	Girl's Bathroom 1313 @ B	SK	Арр	3.28	3/26/2020						-	-
1021-3	Girl's Bathroom 1313 @ C	SK	Арр	1.77	3/26/2020						-	-
1021-4	Girl's Bathroom 1313 @ D	SK	Арр	4.81	3/26/2020						-	-
1022-1	Hall by Nurse's Office 1313	WF	Арр	4	3/26/2020						-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-1	Custodial Closet by 1313	SS	N/A		3/26/2020					Sign Posted	-	-
1024-1	Boy's Bathroom 1315 @ A	SK	Арр	<1.0	3/26/2020						-	-
1024-2	Boy's Bathroom 1315 @ B	SK	Арр	2.06	3/26/2020						-	-
1024-3	Boy's Bathroom 1315 @ C	SK	Арр	2.1	3/26/2020						-	-
1024-4	Boy's Bathroom 1315 @ D	SK	Арр	3.5	3/26/2020						-	-
1025-1	Wood Shop 1312	SS	N/A		3/26/2020				Sampling Not Required		-	-
1025-2	Wood Shop 1312	SK	Арр	<1.0	3/26/2020						-	-
1026-1	Hall by 1319	WF	Арр	<1.0	3/26/2020						-	-
1026-2	Hall by 1319	BF	Арр	<1.0	3/26/2020						-	-
1027-1	Room 1314 Kitchenette	SK	Арр	<1.0	3/26/2020						-	-
1027-2	Room 1314 Men's Bathroom	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1027-3	Room 1314 Women's Bathroom	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1027-4	Room 1314 Prep	SK	Арр	3.86	3/26/2020						-	-
1027-5	Room 1314 Handwash	SK	Арр	83.4	3/26/2020					Permanent Sign Posted		
1027-6	Room 1314 Serving Line	SK	Арр	5.34	3/26/2020						-	-
1028-1	Room 1327 Teacher's Station	SK	Арр	31.4	3/26/2020					Permanent Sign Posted		
1028-2	Room 1327 Counter	SK	Арр	15.4	3/26/2020					Permanent Sign Posted		
1028-3	Room 1327 Prep Room	SK	Арр	<1.0	3/26/2020					Sign Posted	-	-
1029-1	Room 1329 Teacher's Station	SK	Арр	10.1	3/26/2020					Sign Posted	-	-
1029-2	Room 1329 Counter	SK	Арр	3.88	3/26/2020					Sign Posted	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1030-1	Room 1331 @ A	SK	Арр	11.7	3/26/2020					Sign Posted	-	-
1030-2	Room 1331 @ B	SK	Арр	5.49	3/26/2020					Sign Posted	-	-
1031-1	Hall by Room 1321	WF	Арр	23.7	3/26/2020					Removed from Service		
1032-1	Hall by 1323	WF	Арр	<1.0	3/26/2020						-	-
1033-1	Hall by Exit 14-left	WF	Арр	<1.0	3/26/2020						-	-
1033-2	Hall by Exit 14-right	WF	Арр	<1.0	3/26/2020						-	-
1033-3	Hall by Exit 14-right	BF	Арр	<1.0	3/26/2020						-	-
1034-1	Boy's Bathroom 1417 @ A	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1034-2	Boy's Bathroom 1417 @ B	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1035-1	Girl's Bathroom 1415 @ A	SK	N/A		3/26/2020				Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1035-2	Girl's Bathroom 1415 @ B	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
1036-1	Room 1410 Prep Room	SK	Арр	<1.0	3/26/2020	-	-	-		Sign Posted	-	-
1037-1	Room 1408 Teacher's Station	SK	Арр	1.29	3/26/2020	-	-	-		Sign Posted	-	-
1037-2	Room 1408 Counter @ A	SK	Арр	2.91	3/26/2020	-	-	-		Sign Posted	-	-
1037-3	Room 1408 Counter @ A	SPY	Арр	2.3	3/26/2020	-	-	-		Sign Posted	-	-
1037-4	Room 1408 Counter @ B	SK	Арр	6.93	3/26/2020	-	-	-		Sign Posted	-	-
1037-5	Room 1408 Pod 1 @ A	SK	Арр	50.6	3/26/2020					Permanent Sign Posted		
1037-6	Room 1408 Pod 1 @ B	SK	Арр	23.6	3/26/2020					Permanent Sign Posted		
1037-7	Room 1408 Pod 2 @ A	SK	Арр	14.2	3/26/2020	-	-	-		-	-	-
1037-8	Room 1408 Pod 2 @ B	SK	Арр	11.1	3/26/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1037-9	Room 1408 Pod 3 @ A	SK	Арр	17.9	3/26/2020					Permanent Sign Posted		
1037-10	Room 1408 Pod 3 @ B	SK	Арр	10.9	3/26/2020	-	-	-		-	-	-
1037-11	Room 1408 Pod 4 @ A	SK	Арр	7.2	3/26/2020	-	-	-		-	-	-
1037-12	Room 1408 Pod 4 @ B	SK	Арр	11.5	3/26/2020	-	-	-		-	-	-
1037-13	Room 1408 Pod 5 @ A	SK	Арр	13.4	3/26/2020	-	-	-		-	-	-
1037-14	Room 1408 Pod 5 @ B	SK	Арр	16.2	3/26/2020					Permanent Sign Posted		
1037-15	Room 1408 Pod 6 @ A	SK	Арр	16.5	3/26/2020					Permanent Sign Posted		
1037-16	Room 1408 Pod 6 @ B	SK	Арр	21.4	3/26/2020					Permanent Sign Posted		
1038-1	Room 1406 Teacher's Station	SK	Арр	1.93	3/26/2020	-	-	-		Sign Posted	-	-
1038-2	Room 1406 Counter @ A	SK	Арр	4.84	3/26/2020	-	-	-		Sign Posted	-	-
1038-3	Room 1406 Counter @ A	SPY	Арр	12.8	3/26/2020	-	-	-		Sign Posted	-	-
1038-4	Room 1406 Counter @ B	SK	Арр	2.64	3/26/2020	-	-	-		Sign Posted	-	-
1038-5	Room 1406 Pod 1 @ A	SK	Арр	7.4	3/26/2020	-	-	-		-	-	-
1038-6	Room 1406 Pod 1 @ B	SK	Арр	12.2	3/26/2020	-	-	-		-	-	-
1038-7	Room 1406 Pod 2 @ A	SK	Арр	9.48	3/26/2020	-	-	-		-	-	-
1038-8	Room 1406 Pod 2 @ B	SK	Арр	9.46	3/26/2020	-	-	-		-	-	-
1038-9	Room 1406 Pod 3 @ A	SK	Арр	10.7	3/26/2020	-	-	-		-	-	-
1038-10	Room 1406 Pod 3 @ B	SK	Арр	5.57	3/26/2020	-	-	-		-	-	-
1038-11	Room 1406 Pod 4 @ A	SK	Арр	3.5	3/26/2020	-	-	-		-	-	-
1038-12	Room 1406 Pod 4 @ B	SK	Арр	4.46	3/26/2020	-	-	-		-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1038-13	Room 1406 Pod 5 @ A	SK	Арр	3.35	3/26/2020	-	-	-		-	-	-
1038-14	Room 1406 Pod 5 @ B	SK	Арр	4.84	3/26/2020	-	-	-		-	-	-
1038-15	Room 1406 Pod 6 @ A	SK	Арр	11.3	3/26/2020	-	-	-		-	-	-
1038-16	Room 1406 Pod 6 @ B	SK	Арр	6.23	3/26/2020	-	-	-		-	-	-
1039-1	Room 1404 Prep Room	SK	Арр	<1.0	3/26/2020	-	-	-		Sign Posted	-	-
1040-1	Room 1402 Teachers' Station	SK	Арр	2.17	3/26/2020	-	-	-		-	-	-
1040-2	Room 1402 Counter @ A	SK	Арр	3.72	3/26/2020	-	-	-		-	-	-
1040-3	Room 1402 Counter @ A	SPY	Арр	2.27	3/26/2020	-	-	-		-	-	-
1040-4	Room 1402 Counter @ B	SK	Арр	11.1	3/26/2020	-	-	-		-	-	-
1040-5	Room 1402 Pod 1 @ A	SK	Арр	8.15	3/26/2020	-	-	-		-	-	-
1040-6	Room 1402 Pod 1 @ B	SK	Арр	19.8	3/26/2020					Permanent Sign Posted		
1040-7	Room 1402 Pod 2 @ A	SK	Арр	8.94	3/26/2020	-	-	-		-	-	-
1040-8	Room 1402 Pod 2 @ B	SK	Арр	17.6	3/26/2020					Permanent Sign Posted		
1040-9	Room 1402 Pod 3 @ A	SK	Арр	4.71	3/26/2020	-	-	-		-	-	-
1040-10	Room 1402 Pod 3 @ B	SK	Арр	4.91	3/26/2020	-	-	-		-	-	-
1040-11	Room 1402 Pod 4 @ A	SK	Арр	6.74	3/26/2020	-	-	-		-	-	-
1040-12	Room 1402 Pod 4 @ B	SK	Арр	3.18	3/26/2020	-	-	-		-	-	-
1040-13	Room 1402 Pod 5 @ A	SK	Арр	10.6	3/26/2020	-	-	-		-	-	-
1040-14	Room 1402 Pod 5 @ B	SK	Арр	6.81	3/26/2020	-	-	-		-	-	-
1040-15	Room 1402 Pod 6 @ A	SK	Арр	9.7	3/26/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1040-16	Room 1402 Pod 6 @ B	SK	Арр	7.17	3/26/2020	-	-	-		-	-	-
2001-1	Hall by Room 2202	WF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2001-2	Hall by Room 2202	BF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2002-1	Hall by Room 2208	WF	Арр	4.67	3/26/2020	-	-	-		-	-	-
2003-1	Bathroom 2214 Left	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2003-2	Bathroom 2214 Right	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2004-1	Girl's Bathroom 2209 @ A	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2004-2	Girl's Bathroom 2209 @ B	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2004-3	Girl's Bathroom 2209 @ C	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2004-4	Girl's Bathroom 2209 @ D	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2005-1	Boy's Bathroom 2209A @ A	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2005-2	Boy's Bathroom 2209A @ B	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2005-3	Boy's Bathroom 2209A @ C	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2005-4	Boy's Bathroom 2209A @ D	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2006-1	Room 2201 Counter @ A	SK	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2006-2	Room 2201 Counter @ B	SK	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2006-3	Room 2201 Bathroom	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2007-1	Hall by Room 2201	WF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2007-2	Hall by Room 2201	BF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2008-1	Room 2109 Counter	SK	Арр	2.52	3/26/2020	-	-	-		Sign Posted	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-2	Room 2109 Unit @ A	SK	Арр	12.9	3/26/2020	-	-	-		Sign Posted	-	-
2008-3	Room 2109 Unit @ B	SK	Арр	12.2	3/26/2020	-	-	-		Sign Posted	-	-
2008-4	Room 2109 Unit @ C	SK	Арр	5.95	3/26/2020	-	-	-		Sign Posted	-	-
2009-1	Room 2105 Unit @ A	SK	Арр	21.1	3/26/2020					Permanent Sign Posted		
2009-2	Room 2105 Unit @ B	SK	Арр	19.6	3/26/2020					Permanent Sign Posted		
2009-3	Room 2105 Unit @ C	SK	Арр	26.7	3/26/2020					Permanent Sign Posted		
2010-1	Room 2103 Unit @ A	SK	Арр	20.2	3/26/2020					Permanent Sign Posted		
2010-2	Room 2103 Unit @ B	SK	Арр	27.4	3/26/2020					Permanent Sign Posted		
2010-3	Room 2103 Unit @ C	SK	Арр	30.3	3/26/2020					Permanent Sign Posted		
2011-1	Hall by Room 2301	WF	Арр	3.39	3/26/2020	-	-	-		-	-	-
2012-1	Room 2301	SK	Арр	20.9	3/26/2020					Permanent Sign Posted		
2013-1	Hall by Room 2309	WF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2014-1	Room 2309	SK	Арр	9.23	3/26/2020	-	-	-		-	-	-
2015-1	Girl's Bathroom 2315 @ A	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2015-2	Girl's Bathroom 2315 @ B	SK	Арр	4.83	3/26/2020	-	-	-		-	-	-
2015-3	Girl's Bathroom 2315 @ C	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2015-4	Girl's Bathroom 2315 @ D	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2016-1	Hall by Room 2315	WF	N/A		3/26/2020	-	-	-		Sign Posted	-	-
2017-1	Custodial Closet by Room 2315	SS	N/A		3/26/2020	-	-	-		Sign Posted	-	-
2018-1	Boy's Bathroom 2317 @ A	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-



Rockvi	ille C	entre	UFSD
South	Side	Hiah	School

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2018-2	Boy's Bathroom 2317 @ B	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2018-3	Boy's Bathroom 2317 @ C	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2018-4	Boy's Bathroom 2317 @ D	SK	Арр	8.04	3/26/2020	-	-	-		-	-	-
2019-1	Hall by Room 2326	WF	Арр	5.33	3/26/2020	-	-	-		-	-	-
2020-1	Men's Faculty Bathroom 2321	SK	Арр	1.91	3/26/2020	-	-	-		-	-	-
2021-1	Women's Faculty Bathroom 2333	SK	Арр	7.69	3/26/2020	-	-	-		-	-	-
2022-1	Hall by Room 2323	WF	Арр	2.52	3/26/2020	-	-	-		-	-	-
2023-1	Hall by Room 2327	WF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2024-1	Custodial Closet 2407	SS	N/A		3/26/2020	-	-	-		Sign Posted	-	-
2025-1	Hall by Room 2407	WF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2025-2	Hall by Room 2407	WF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2025-3	Hall by Room 2407	BF	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2026-1	Boy's Bathroom 2409 @ A	SK	N/A		3/26/2020	-	-	=	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2026-2	Boy's Bathroom 2409 @ B	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2027-1	Girl's Bathroom 2411 @ A	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2027-2	Girl's Bathroom 2411 @ B	SK	N/A		3/26/2020	-	-	-	Mixed Valve Sampling Not Required	Permanent Sign Posted	-	-
2028-1	Room 2414 Teacher's Station	SK	Арр	2.62	3/26/2020	-	-	-		-	-	-
2028-2	Room 2414 Counter @ A	SK	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2028-3	Room 2414 Counter @ A	SPY	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2028-4	Room 2414 Fume Hood	SP	Арр	15.7	3/26/2020					Permanent Sign Posted		



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2028-5	Room 2414 Counter @ B	SK	Арр	<1.0	3/26/2020	-	-	-		-	-	-
2028-6	Room 2414 Pod 1 @ A	SK	Арр	4.55	3/26/2020	-	-	-		-	-	-
2028-7	Room 2414 Pod 1 @ B	SK	Арр	9.62	3/26/2020	-	-	-		-	-	-
2028-8	Room 2414 Pod 2 @ A	SK	Арр	12.7	3/26/2020	-	-	-		-	-	-
2028-9	Room 2414 Pod 2 @ B	SK	Арр	8.54	3/26/2020	-	-	-		-	-	-
2028-10	Room 2414 Pod 3 @ A	SK	Арр	6.12	3/26/2020	-	-	-		-	-	-
2028-11	Room 2414 Pod 3 @ B	SK	Арр	14.6	3/26/2020	-	-	-		-	-	-
2028-12	Room 2414 Pod 4 @ A	SK	Арр	13.8	3/26/2020	-	-	-		-	-	-
2028-13	Room 2414 Pod 4 @ B	SK	Арр	4.92	3/26/2020	-	-	-		-	-	-
2028-14	Room 2414 Pod 5 @ A	SK	Арр	11.6	3/26/2020	-	-	-		-	-	-
2028-15	Room 2414 Pod 5 @ B	SK	Арр	11.6	3/26/2020	-	-	-		-	-	-
2028-16	Room 2414 Pod 6 @ A	SK	Арр	6.78	3/26/2020	-	-	-		-	-	-
2028-17	Room 2414 Pod 6 @ B	SK	Арр	8.83	3/26/2020	-	-	-		-	-	-
2029-1	Room 2412 Prep	SK	Арр	1.28	3/26/2020	-	-	-		Sign Posted	-	-
2030-1	Room 2410 Teacher's Station	SK	Арр	1.23	3/26/2020	-	-	-		-	-	-
2030-2	Room 2410 Counter @ A	SK	Арр	3.15	3/26/2020	-	-	-		-	-	-
2030-3	Room 2410 Counter @ B	SK	Арр	2.15	3/26/2020	-	-	-		-	-	-
2030-4	Room 2410 Counter @ B	SPY	Арр	1.16	3/26/2020	-	-	-		-	-	-
2030-5	Room 2410 Fume Hood	SP	Арр	27.9	3/26/2020					Permanent Sign Posted		
2030-6	Room 2410 Pod 1 @ A	SK	Арр	8.35	3/26/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2030-7	Room 2410 Pod 1 @ B	SK	Арр	2.66	3/26/2020	-	-	-		-	-	-
2030-8	Room 2410 Pod 2 @ A	SK	Арр	8.74	3/26/2020	-	-	-		-	-	-
2030-9	Room 2410 Pod 2 @ B	SK	Арр	5.21	3/26/2020	-	-	-		-	-	-
2030-10	Room 2410 Pod 3 @ A	SK	Арр	5.64	3/26/2020	-	-	-		-	-	-
2030-11	Room 2410 Pod 3 @ B	SK	Арр	5.16	3/26/2020	-	-	-		-	-	-
2030-12	Room 2410 Pod 4 @ A	SK	Арр	4.87	3/26/2020	-	-	-		-	-	-
2030-13	Room 2410 Pod 4 @ B	SK	Арр	4.6	3/26/2020	-	-	-		-	-	-
2030-14	Room 2410 Pod 5 @ A	SK	Арр	2.76	3/26/2020	-	-	-		-	-	-
2030-15	Room 2410 Pod 5 @ B	SK	Арр	2.8	3/26/2020	-	-	-		-	-	-
2030-16	Room 2410 Pod 6 @ A	SK	Арр	4.12	3/26/2020	-	-	-		-	-	-
2030-17	Room 2410 Pod 6 @ B	SK	Арр	6.18	3/26/2020	-	-	-		-	-	-
2031-1	Room 2408 Teacher's Station	SK	Арр	<1.0	3/26/2020	-	-	-		Sign Posted	-	-
2031-2	Room 2408 Fume Hood	SP	Арр	14.6	3/26/2020	-	-	-		-	-	-
2031-3	Room 2408 Counter	SK	Арр	2.29	3/26/2020	-	-	-		Sign Posted	-	-
2031-4	Room 2408 Pod 1 @ A	SK	Арр	8.54	3/26/2020	-	-	-		-	-	-
2031-5	Room 2408 Pod 1 @ B	SK	Арр	3.66	3/26/2020	-	-	-		-	-	-
2031-6	Room 2408 Pod 2 @ A	SK	Арр	4.64	3/26/2020	-	-	-		-	-	-
2031-7	Room 2408 Pod 2 @ B	SK	Арр	3.5	3/26/2020	-	-	-		-	-	-
2031-8	Room 2408 Pod 3 @ A	SK	Арр	4.67	3/26/2020	-	-	-		-	-	-
2031-9	Room 2408 Pod 3 @ B	SK	Арр	1.8	3/26/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2031-10	Room 2408 Pod 4 @ A	SK	Арр	2.84	3/26/2020	-	-	-		-	-	-
2031-11	Room 2408 Pod 4 @ B	SK	Арр	4.04	3/26/2020	-	-	-		-	-	-
2031-12	Room 2408 Pod 5 @ A	SK	Арр	3.72	3/26/2020	-	-	-		-	-	-
2031-13	Room 2408 Pod 5 @ B	SK	Арр	4.18	3/26/2020	-	-	-		-	-	-
2031-14	Room 2408 Pod 6 @ A	SK	Арр	2.12	3/26/2020	-	-	-		-	-	-
2031-15	Room 2408 Pod 6 @ B	SK	Арр	2.78	3/26/2020	-	-	-		-	-	-
2032-1	Room 2406 Prep	SK	Арр	5.07	3/26/2020	-	-	-		-	-	-
2032-2	Room 2406 Prep Fume Hood	SK	Арр	46.3	3/26/2020					Permanent Sign Posted		
2033-1	Room 2404 Teacher's Station	SK	Арр	1.09	3/26/2020	-	-	-		Sign Posted	-	-
2033-2	Room 2404 Fume Hood	SP	Арр	1.22	3/26/2020	-	-	-		Sign Posted	-	-
2033-3	Room 2404 Counter	SK	Арр	181	3/26/2020					Permanent Sign Posted		
2033-4	Room 2404 Pod 1 @ A	SK	Арр	4.67	3/26/2020	-	-	-		-	-	-
2033-5	Room 2404 Pod 1 @ B	SK	Арр	13.2	3/26/2020	-	-	-		-	-	-
2033-6	Room 2404 Pod 2 @ A	SK	Арр	9.14	3/26/2020	-	-	-		-	-	-
2033-7	Room 2404 Pod 2 @ B	SK	Арр	3.93	3/26/2020	-	-	-		-	-	-
2033-8	Room 2404 Pod 3 @ A	SK	Арр	6.62	3/26/2020	-	-	-		-	-	-
2033-9	Room 2404 Pod 3 @ B	SK	Арр	2.55	3/26/2020	-	-	-		-	-	-
2033-10	Room 2404 Pod 4 @ A	SK	Арр	6.98	3/26/2020	-	-	-		-	-	-
2033-11	Room 2404 Pod 4 @ B	SK	Арр	4.51	3/26/2020	-	-	-		-	-	-
2033-12	Room 2404 Pod 5 @ A	SK	Арр	4.95	3/26/2020	-	-	-		-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2033-13	Room 2404 Pod 5 @ B	SK	Арр	4.93	3/26/2020	-	-	-		-	-	-
2033-14	Room 2404 Pod 6 @ A	SK	Арр	5.99	3/26/2020	-	-	-		-	-	-
2033-15	Room 2404 Pod 6 @ B	SK	Арр	3.96	3/26/2020	-	-	-		-	-	-
2034-1	Room 2402 Prep	SK	Арр	8.48	3/26/2020	-	-	-		-	-	-
2035-1	Room 2320 Teacher's Station	SK	Арр	5.09	3/26/2020	-	-	-		Sign Posted	-	-
2035-2	Room 2320 Fume Hood	SK	Арр	10	3/26/2020	-	-	-		-	-	-
2035-3	Room 2320 Counter 1	SK	Арр	<1.0	3/26/2020	-	-	-		Sign Posted	-	-
2035-4	Room 2320 Counter 2	SK	Арр	<1.0	3/26/2020	-	-	-		Sign Posted	-	-
2035-5	Room 2320 Back Room 2320A	SK	Арр	2	3/26/2020	-	-	-		Sign Posted	-	-
0001-1	Boiler Room by Laundry Machine	SS	N/A	<1.0	3/26/2020	-	-	-		Sign Posted	-	-
0002-1	Basement Break Room	SK	Арр	1.21	3/26/2020	-	-	-		-	-	-
0003-1	Basement Water Valves Room	SS	N/A		3/26/2020	-	-	-		Sign Posted	-	-
0004-1	Basement Boy's Locker Room Bathroom @ A	SK	Арр	1.21	3/26/2020	-	-	-		-	-	-
0004-2	Basement Boy's Locker Room Bathroom @ B	SK	Арр	1.37	3/26/2020	-	-	-		-	-	-
0004-3	Basement Boy's Locker Room	WF	Арр	2.51	3/26/2020	-	-	-		-	-	-
0004-4	Basement Boy's Locker Room	IM	Арр	<1.0	3/26/2020	-	-	-		-	-	-





Laboratory Report

NYE Report #: 2201412-14318

March 31, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Rockville UFSD; South Side High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on March 28, 2020. New York Environmental analyzed the samples on March 27, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
	20 11101 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J001	1	Kitchen Handwash by Fridge-SK; Initial	1.00	1.20	μg/L	
200328J002	2	Kitchen Ice Machine-IM; Initial	1.00	<1.00	μg/L	
200328J003	3	Kitchen Handwash by Ice Machine -SK; Initial	1.00	4.51	μg/L	
200328J004	4	Kitchen 2-Bay @ A-SK; Initial	1.00	1.49	μg/L	
200328J005	5	Kitchen 2-Bay @ B-SK; Initial	1.00	<1.00	μg/L	
200328J006	6	Kitchen Bathroom-SK; Initial	1.00	5.11	μg/L	
200328J007	7	Kitchen 3-Bay @ A-SK; Initial	1.00	<1.00	μg/L	
200328J008	8	Kitchen 3-Bay @ A-SPY; Initial	1.00	<1.00	μg/L	
200328J009	9	Kitchen 3-Bay @ B-SK; Initial	1.00	1.46	μg/L	
200328J010	10	Kitchen Handwash by Bathroom-SK; Initial	1.00	<1.00	μg/L	
200328J011	11	Kitchen Island-SK; Initial	1.00	2.07	μg/L	
200328J012	12	Kitchen handwash by Ice Cream Maker-SK; Initial	1.00	2.14	μg/L	
200328J013	13	Kitchen Serving Line Bain Marie @ A-SP ; Initial	1.00	1.03	μg/L	
200328J014	14	Kitchen Serving Line Bain Marie @ D-SP; Initial	1.00	1.95	μg/L	
200328J015	15	Main Office Women's Bathroom-SK; Initial	1.00	1.89	μg/L	
200328J016	16	Main Office Men's Bathroom-SK; Initial	1.00	1.13	μg/L	
200328J017	17	Hall by Main Office-WF; Initial	1.00	2.54	μg/L	
200328J018	18	Lobby Men's Faculty Bathroom-SK; Initial	1.00	5.53	μg/L	
200328J019	19	Lobby Women's Faculty Bathroom @A-SK; Initial	1.00	1.44	μg/L	
200328J020	20	Lobby Women's Faculty Bathroom @B-SK; Initial	1.00	4.35	μg/L	
200328J021	21	Room 1203 Music-WF; Initial	1.00	<1.00	μg/L	
200328J022	22	Room 1203 Music -BF; Initial	1.00	<1.00	μg/L	
200328J023	23	Room 1203 Music-SK; Initial	1.00	<1.00	μg/L	
200328J024	24	Room 1203 Music Bathroom -Right-SK; Initial	1.00	3.00	μg/L	
200328J025	25	Room 1203 Music Bathroom-Left-SK; Initial	1.00	<1.00	μg/L	
200328J026	26	Hall by Room 1203-WF; Initial	1.00	7.34	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J027	27	Hall by Room 1109 Bathroom-left-WF; Initial	1.00	<1.00	μg/L	
200328J028	28	Hall by Room 1109 Bathroom-WF; Initial	1.00	<1.00	μg/L	
200328J029	29	Hall by Room 1109 Bathroom-BF; Initial	1.00	<1.00	μg/L	
200328J030	30	Fitness Room 1107-right-WF; Initial	1.00	<1.00	μg/L	
200328J031	31	Fitness Room 1107-left-WF; Initial	1.00	<1.00	μg/L	
200328J032	32	Fitness Room 1107-left-BF; Initial	1.00	<1.00	μg/L	
200328J033	33	Girl's Locker Room Coach's Bathroom-SK; Initial	1.00	1.34	μg/L	
200328J034	34	Girl's Locker Room -WF; Initial	1.00	6.54	μg/L	
200328J035	35	Girl's Locker Room Bathroom @ A-SK; Initial	1.00	1.49	μg/L	
200328J036	36	Girl's Locker Room Bathroom @ B-SK; Initial	1.00	2.34	μg/L	
200328J037	37	Girl's Locker Room Ice Machine-IM; Initial	1.00	<1.00	μg/L	
200328J038	38	Hall by Room 1303-WF; Initial	1.00	1.38	μg/L	
200328J039	39	Boy's Locker Room Coach's Bathroom-SK; Initial	1.00	30.2	μg/L	Н
200328J040	40	Boy's Locker Room Bathroom @ A-SK; Initial	1.00	2.90	μg/L	
200328J041	41	Boy's Locker Room Bathroom @ B-SK; Initial	1.00	1.41	μg/L	
200328J042	42	Boy's Locker Room Bathroom @ C-SK; Initial	1.00	10.9	μg/L	
200328J043	43	Boy's Locker Room-WF; Initial	1.00	1.91	μg/L	
200328J044	44	Boiler Room Bathroom-SK; Initial	1.00	1.06	μg/L	
200328J045	45	Nurse's Office Bathroom-SK; Initial	1.00	2.54	μg/L	
200328J046	46	Nurse's Office Exam Room-SK; Initial	1.00	10.7	μg/L	
200328J047	47	Girl's Bathroom 1313 @ A-SK; Initial	1.00	2.11	μg/L	
200328J048	48	Girl's Bathroom 1313 @ B-SK; Initial	1.00	3.28	μg/L	
200328J049	49	Girl's Bathroom 1313 @ C-SK; Initial	1.00	1.77	μg/L	
200328J050	50	Girl's Bathroom 1313 @ D-SK; Initial	1.00	4.81	μg/L	
200328J051	51	Hall by Nurse's Office-WF; Initial	1.00	4.00	μg/L	
200328J052	52	Boy's Bathroom 1315 @ A-SK; Initial	1.00	<1.00	μg/L	
200328J053	53	Boy's Bathroom 1315 @ B-SK; Initial	1.00	2.06	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J054	54	Boy's Bathroom 1315 @ C-SK; Initial	1.00	2.10	μg/L	
200328J055	55	Boy's Bathroom 1315 @ D-SK; Initial	1.00	3.50	μg/L	
200328J056	56	Wood Shop 1312-SK; Initial	1.00	<1.00	μg/L	
200328J057	57	Hall by 1319-WF; Initial	1.00	<1.00	μg/L	
200328J058	58	Hall by 1319-BF; Initial	1.00	<1.00	μg/L	
200328J059	59	Room 1314 Kitchenette-SK; Initial	1.00	<1.00	μg/L	
200328J060	60	Room 1314 Prep -SK; Initial	1.00	3.86	μg/L	
200328J061	61	Room 1314 Handwash-SK; Initial	1.00	83.4	μg/L	E,H
200328J062	62	Room 1314 Serving Line-SK; Initial	1.00	5.34	μg/L	
200328J063	63	Room 1327 Teacher's Station-SK; Initial	1.00	31.4	μg/L	Н
200328J064	64	Room 1327 Counter-SK; Initial	1.00	15.4	μg/L	Н
200328J065	65	Room 1327 Prep Room-SK; Initial	1.00	<1.00	μg/L	
200328J066	66	Room 1329 Teacher's Station-SK; Initial	1.00	10.1	μg/L	
200328J067	67	Room 1329 Counter-SK; Initial	1.00	3.88	μg/L	
200328J068	68	Room 1331 @ A-SK; Initial	1.00	11.7	μg/L	
200328J069	69	Room 1331 @ B-SK; Initial	1.00	5.49	μg/L	
200328J070	70	Hall by Room 1321-WF; Initial	1.00	23.7	μg/L	Н
200328J071	71	Hall by Room 1323-WF; Initial	1.00	<1.00	μg/L	
200328J072	72	Hall by Exit 14-left-WF; Initial	1.00	<1.00	μg/L	
200328J073	73	Hall by Exit 14-right-WF; Initial	1.00	<1.00	μg/L	
200328J074	74	Hall by Exit 14-right-BF; Initial	1.00	<1.00	μg/L	
200328J075	75	Room 1410 Prep Room-SK; Initial	1.00	<1.00	μg/L	
200328J076	76	Room 1408 Teacher's Station-SK; Initial	1.00	1.29	μg/L	
200328J077	77	Room 1408 Counter @ A-SK; Initial	1.00	2.91	μg/L	
200328J078	78	Room 1408 Counter @ A-SPY; Initial	1.00	2.30	μg/L	
200328J079	79	Room 1408 Counter @ B-SK; Initial	1.00	6.93	μg/L	
200328J080	80	Room 1408 Pod 1 @ A-SK; Initial	1.00	50.6	μg/L	E,H



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J081	81	Room 1408 Pod 1 @ B-SK; Initial	1.00	23.6	μg/L	Н
200328J082	82	Room 1408 Pod 2 @ A-SK; Initial	1.00	14.2	μg/L	
200328J083	83	Room 1408 Pod 2 @ B-SK; Initial	1.00	11.1	μg/L	
200328J084	84	Room 1408 Pod 3 @ A-SK; Initial	1.00	17.9	μg/L	Н
200328J085	85	Room 1408 Pod 3 @ B-SK; Initial	1.00	10.9	μg/L	
200328J086	86	Room 1408 Pod 4 @ A-SK; Initial	1.00	7.20	μg/L	
200328J087	87	Room 1408 Pod 4 @ B-SK; Initial	1.00	11.5	μg/L	
200328J088	88	Room 1408 Pod 5 @ A-SK; Initial	1.00	13.4	μg/L	
200328J089	89	Room 1408 Pod 5 @ B-SK; Initial	1.00	16.2	μg/L	Н
200328J090	90	Room 1408 Pod 6 @ A-SK; Initial	1.00	16.5	μg/L	Н
200328J091	91	Room 1408 Pod 6 @ B-SK; Initial	1.00	21.4	μg/L	Н
200328J092	92	Room 1406 Teacher's Station-SK; Initial	1.00	1.93	μg/L	
200328J093	93	Room 1406 Counter @ A-SK; Initial	1.00	4.84	μg/L	
200328J094	94	Room 1406 Counter @ A-SPY; Initial	1.00	12.8	μg/L	
200328J095	95	Room 1406 Counter @ B-SK; Initial	1.00	2.64	μg/L	
200328J096	96	Room 1406 Pod 1 @ A-SK; Initial	1.00	7.40	μg/L	
200328J097	97	Room 1406 Pod 1 @ B-SK; Initial	1.00	12.2	μg/L	
200328J098	98	Room 1406 Pod 2 @ A-SK; Initial	1.00	9.48	μg/L	
200328J099	99	Room 1406 Pod 2 @ B-SK; Initial	1.00	9.46	μg/L	
200328J100	100	Room 1406 Pod 3 @ A-SK; Initial	1.00	10.7	μg/L	
200328J101	101	Room 1406 Pod 3 @ B-SK; Initial	1.00	5.57	μg/L	
200328J102	102	Room 1406 Pod 4 @ A-SK; Initial	1.00	3.50	μg/L	
200328J103	103	Room 1406 Pod 4 @ B-SK; Initial	1.00	4.46	μg/L	
200328J104	104	Room 1406 Pod 5 @ A-SK; Initial	1.00	3.35	μg/L	
200328J105	105	Room 1406 Pod 5 @ B-SK; Initial	1.00	4.84	μg/L	
200328J106	106	Room 1406 Pod 6 @ A-SK; Initial	1.00	11.3	μg/L	
200328J107	107	Room 1406 Pod 6 @ B-SK; Initial	1.00	6.23	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J108	108	Room 1404 Prep Room-SK; Initial	1.00	<1.00	μg/L	
200328J109	109	Room 1402 Teachers' Station-SK; Initial	1.00	2.17	μg/L	
200328J110	110	Room 1402 Counter @ A-SK; Initial	1.00	3.72	μg/L	
200328J111	111	Room 1402 Counter @ A-SPY; Initial	1.00	2.27	μg/L	
200328J112	112	Room 1402 Counter @ B-SK; Initial	1.00	11.1	μg/L	
200328J113	113	Room 1402 Pod 1 @ A-SK; Initial	1.00	8.15	μg/L	
200328J114	114	Room 1402 Pod 1 @ B-SK; Initial	1.00	19.8	μg/L	Н
200328J115	115	Room 1402 Pod 2 @ A-SK; Initial	1.00	8.94	μg/L	
200328J116	116	Room 1402 Pod 2 @ B-SK; Initial	1.00	17.6	μg/L	Н
200328J117	117	Room 1402 Pod 3 @ A-SK; Initial	1.00	4.71	μg/L	
200328J118	118	Room 1402 Pod 3 @ B-SK; Initial	1.00	4.91	μg/L	
200328J119	119	Room 1402 Pod 4 @ A-SK; Initial	1.00	6.74	μg/L	
200328J120	120	Room 1402 Pod 4 @ B-SK; Initial	1.00	3.18	μg/L	
200328J121	121	Room 1402 Pod 5 @ A-SK; Initial	1.00	10.6	μg/L	
200328J122	122	Room 1402 Pod 5 @ B-SK; Initial	1.00	6.81	μg/L	
200328J123	123	Room 1402 Pod 6 @ A-SK; Initial	1.00	9.70	μg/L	
200328J124	124	Room 1402 Pod 6 @ B-SK; Initial	1.00	7.17	μg/L	
200328J125	125	Hall by Room 2202-WF; Initial	1.00	<1.00	μg/L	
200328J126	126	Hall by Room 2202-BF; Initial	1.00	<1.00	μg/L	
200328J127	127	Hall by Room 2208-WF; Initial	1.00	4.67	μg/L	
200328J128	128	Room 2201 Counter @ A-SK; Initial	1.00	<1.00	μg/L	
200328J129	129	Room 2201 Counter @ B-SK; Initial	1.00	<1.00	μg/L	
200328J130	130	Hall by Room 2201-WF; Initial	1.00	<1.00	μg/L	
200328J131	131	Hall by Room 2201-BF; Initial	1.00	<1.00	μg/L	
200328J132	132	Room 2109 Counter-SK; Initial	1.00	2.52	μg/L	
200328J133	133	Room 2109 Unit @ A-SK; Initial	1.00	12.9	μg/L	
200328J134	134	Room 2109 Unit @ B-SK; Initial	1.00	12.2	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J135	135	Room 2109 Unit @ C-SK; Initial	1.00	5.95	μg/L	
200328J136	136	Room 2105 Unit @ A-SK; Initial	1.00	21.1	μg/L	Н
200328J137	137	Room 2105 Unit @ B-SK; Initial	1.00	19.6	μg/L	Н
200328J138	138	Room 2105 Unit @ C-SK; Initial	1.00	26.7	μg/L	Н
200328J139	139	Room 2103 Unit @ A-SK; Initial	1.00	20.2	μg/L	Н
200328J140	140	Room 2103 Unit @ B-SK; Initial	1.00	27.4	μg/L	Н
200328J141	141	Room 2103 Unit @ C-SK; Initial	1.00	30.3	μg/L	Н
200328J142	142	Hall by Room 2301-WF; Initial	1.00	3.39	μg/L	
200328J143	143	Room 2301-SK; Initial	1.00	20.9	μg/L	Н
200328J144	144	Hall by Room 2309-WF; Initial	1.00	<1.00	μg/L	
200328J145	145	Room 2309-SK; Initial	1.00	9.23	μg/L	
200328J146	146	Girl's Bathroom 2315 @ B-SK; Initial	1.00	4.83	μg/L	
200328J147	147	Hall by Room 2316-WF; Initial	1.00	4.15	μg/L	
200328J148	148	Boy's Bathroom 2317 @ D-SK; Initial	1.00	8.04	μg/L	
200328J149	149	Hall by Room 2326-WF; Initial	1.00	5.33	μg/L	
200328J150	150	Men's Faculty Bathroom 2321-SK; Initial	1.00	1.91	μg/L	
200328J151	151	Women's Faculty Bathroom 2333-SK; Initial	1.00	7.69	μg/L	
200328J152	152	Hall by Room 2323-WF; Initial	1.00	2.52	μg/L	
200328J153	153	Hall by Room 2327-WF; Initial	1.00	<1.00	μg/L	
200328J154	154	Hall by Room 2407-WF; Initial	1.00	<1.00	μg/L	
200328J155	155	Hall by Room 2407-WF; Initial	1.00	<1.00	μg/L	
200328J156	156	Hall by Room 2407-BF; Initial	1.00	<1.00	μg/L	
200328J157	157	Room 2414 Teacher's Station-SK; Initial	1.00	2.62	μg/L	
200328J158	158	Room 2414 Counter @ A-SK; Initial	1.00	<1.00	μg/L	
200328J159	159	Room 2414 Counter @ A-SPY; Initial	1.00	<1.00	μg/L	
200328J160	160	Room 2414 Fume Hood-SP; Initial	1.00	15.7	μg/L	Н
200328J161	161	Room 2414 Counter @ B-SK; Initial	1.00	<1.00	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J162	162	Room 2414 Pod 1 @ A-SK; Initial	1.00	4.55	μg/L	
200328J163	163	Room 2414 Pod 1 @ B-SK; Initial	1.00	9.62	μg/L	
200328J164	164	Room 2414 Pod 2 @ A-SK; Initial	1.00	12.7	μg/L	
200328J165	165	Room 2414 Pod 2 @ B-SK; Initial	1.00	8.54	μg/L	
200328J166	166	Room 2414 Pod 3 @ A-SK; Initial	1.00	6.12	μg/L	
200328J167	167	Room 2414 Pod 3 @ B-SK; Initial	1.00	14.6	μg/L	
200328J168	168	Room 2414 Pod 4 @ A-SK; Initial	1.00	13.8	μg/L	
200328J169	169	Room 2414 Pod 4 @ B-SK; Initial	1.00	4.92	μg/L	
200328J170	170	Room 2414 Pod 5 @ A-SK; Initial	1.00	11.6	μg/L	
200328J171	171	Room 2414 Pod 5 @ B-SK; Initial	1.00	11.6	μg/L	
200328J172	172	Room 2414 Pod 6 @ A-SK; Initial	1.00	6.78	μg/L	
200328J173	173	Room 2414 Pod 6 @ B-SK; Initial	1.00	8.83	μg/L	
200328J174	174	Room 2412 Prep-SK; Initial	1.00	1.28	μg/L	
200328J175	175	Room 2410 Teacher's Station-SK; Initial	1.00	1.23	μg/L	
200328J176	176	Room 2410 Counter @ A-SK; Initial	1.00	3.15	μg/L	
200328J177	177	Room 2410 Counter @ B-SK; Initial	1.00	2.15	μg/L	
200328J178	178	Room 2410 Counter @ B-SPY; Initial	1.00	1.16	μg/L	
200328J179	179	Room 2410 Fume Hood-SP; Initial	1.00	27.9	μg/L	Н
200328J180	180	Room 2410 Pod 1 @ A-SK; Initial	1.00	8.35	μg/L	
200328J181	181	Room 2410 Pod 1 @ B-SK; Initial	1.00	2.66	μg/L	
200328J182	182	Room 2410 Pod 2 @ A-SK; Initial	1.00	8.74	μg/L	
200328J183	183	Room 2410 Pod 2 @ B-SK; Initial	1.00	5.21	μg/L	
200328J184	184	Room 2410 Pod 3 @ A-SK; Initial	1.00	5.64	μg/L	
200328J185	185	Room 2410 Pod 3 @ B-SK; Initial	1.00	5.16	μg/L	
200328J186	186	Room 2410 Pod 4 @ A-SK; Initial	1.00	4.87	μg/L	
200328J187	187	Room 2410 Pod 4 @ B-SK; Initial	1.00	4.60	μg/L	
200328J188	188	Room 2410 Pod 5 @ A-SK; Initial	1.00	2.76	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J189	189	Room 2410 Pod 5 @ B-SK; Initial	1.00	2.80	μg/L	
200328J190	190	Room 2410 Pod 6 @ A-SK; Initial	1.00	4.12	μg/L	
200328J191	191	Room 2410 Pod 6 @ B-SK; Initial	1.00	6.18	μg/L	
200328J192	192	Room 2408 Teacher's Station-SK; Initial	1.00	<1.00	μg/L	
200328J193	193	Room 2408 Fume Hood-SP; Initial	1.00	14.6	μg/L	
200328J194	194	Room 2408 Counter-SK; Initial	1.00	2.29	μg/L	
200328J195	195	Room 2408 Pod 1 @ A-SK; Initial	1.00	8.54	μg/L	
200328J196	196	Room 2408 Pod 1 @ B-SK; Initial	1.00	3.66	μg/L	
200328J197	197	Room 2408 Pod 2 @ A-SK; Initial	1.00	4.64	μg/L	
200328J198	198	Room 2408 Pod 2 @ B-SK; Initial	1.00	3.50	μg/L	
200328J199	199	Room 2408 Pod 3 @ A-SK; Initial	1.00	4.67	μg/L	
200328J200	200	Room 2408 Pod 3 @ B-SK; Initial	1.00	1.80	μg/L	
200328J201	201	Room 2408 Pod 4 @ A-SK; Initial	1.00	2.84	μg/L	
200328J202	202	Room 2408 Pod 4 @ B-SK; Initial	1.00	4.04	μg/L	
200328J203	203	Room 2408 Pod 5 @ A-SK; Initial	1.00	3.72	μg/L	
200328J204	204	Room 2408 Pod 5 @ B-SK; Initial	1.00	4.18	μg/L	
200328J205	205	Room 2408 Pod 6 @ A-SK; Initial	1.00	2.12	μg/L	
200328J206	206	Room 2408 Pod 6 @ B-SK; Initial	1.00	2.78	μg/L	
200328J207	207	Room 2406 Prep-SK; Initial	1.00	5.07	μg/L	
200328J208	208	Room 2406 Prep Fume Hood-SK; Initial	1.00	46.3	μg/L	Н
200328J209	209	Room 2404 Teacher's Station-SK; Initial	1.00	1.09	μg/L	
200328J210	210	Room 2404 Fume Hood-SP; Initial	1.00	1.22	μg/L	
200328J211	211	Room 2404 Counter-SK; Initial	1.00	181	μg/L	E,H
200328J212	212	Room 2404 Pod 1 @ A-SK; Initial	1.00	4.67	μg/L	
200328J213	213	Room 2404 Pod 1 @ B-SK; Initial	1.00	13.2	μg/L	
200328J214	214	Room 2404 Pod 2 @ A-SK; Initial	1.00	9.14	μg/L	
200328J215	215	Room 2404 Pod 2 @ B-SK; Initial	1.00	3.93	μg/L	



Date Collected:	26 Mar 2020
Date Received:	28 Mar 2020
Date Analyzed:	27 Mar 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200328J216	216	Room 2404 Pod 3 @ A-SK; Initial	1.00	6.62	μg/L	
200328J217	217	Room 2404 Pod 3 @ B-SK; Initial	1.00	2.55	μg/L	
200328J218	218	Room 2404 Pod 4 @ A-SK; Initial	1.00	6.98	μg/L	
200328J219	219	Room 2404 Pod 4 @ B-SK; Initial	1.00	4.51	μg/L	
200328J220	220	Room 2404 Pod 5 @ A-SK; Initial	1.00	4.95	μg/L	
200328J221	221	Room 2404 Pod 5 @ B-SK; Initial	1.00	4.93	μg/L	
200328J222	222	Room 2404 Pod 6 @ A-SK; Initial	1.00	5.99	μg/L	
200328J223	223	Room 2404 Pod 6 @ B-SK; Initial	1.00	3.96	μg/L	
200328J224	224	Room 2402 Prep-SK; Initial	1.00	8.48	μg/L	
200328J225	225	Room 2320 Teacher's Station-SK; Initial	1.00	5.09	μg/L	
200328J226	226	Room 2320 Fume Hood-SK; Initial	1.00	10.0	μg/L	
200328J227	227	Room 2320 Counter 1-SK; Initial	1.00	<1.00	μg/L	
200328J228	228	Room 2320 Counter 2-SK; Initial	1.00	<1.00	μg/L	
200328J229	229	Room 2320 Back Room 2320A-SK; Initial	1.00	2.00	μg/L	
200328J230	230	Basement Break Room-SK; Initial	1.00	<1.00	μg/L	
200328J231	231	Basement Boy's Locker Room Bathroom @ A-SK; Initial	1.00	1.21	μg/L	
200328J232	232	Basement Boy's Locker Room Bathroom @ B-SK; Initial	1.00	1.37	μg/L	
200328J233	233	Basement Boy's Locker Room-WF; Initial	1.00	2.51	μg/L	
200328J234	234	Basement Boy's Locker Room-IM; Initial	1.00	<1.00	μg/L	

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

